


	GROUP Body	MODEL 2014MY Forte (YD)
	NUMBER PS396	DATE April 2015



TECHNICAL OPERATIONS

SUBJECT: WATER LEAKING INTO TRUNK AND/OR REAR FLOORBOARD AREA

On some 2014MY Forte (YD) vehicles, produced prior to May 21, 2014, customers may complain of water leaking into the trunk and/or rear floorboard area, after a rainstorm or a carwash. This condition may be caused by improper sealing between the outer tail lamp (A) gasket and the body of the vehicle. To resolve this concern, replace the existing gaskets with the improved parts on both outer tail lamp assemblies. **NOTE: Do NOT order the complete outer tail lamp assembly to resolve this concern.**

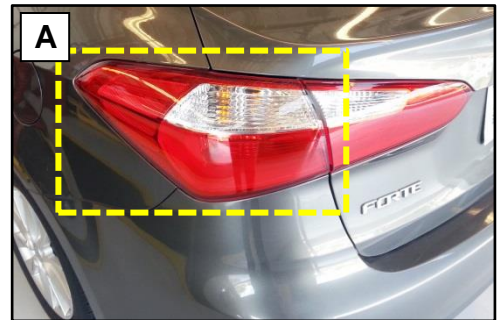

NOTE: The improved gasket for the outer tail lamps is made from a different, darker-colored material and is 1mm thicker than the original part (B).

