




	GROUP Body Electrical	MODEL 2015MY Sedona (YP)
	NUMBER PS389	DATE March 2015
 		
SUBJECT: SEDONA (YP) – INSTRUMENT CLUSTER VARIANT CODING		

This article provides information related to variant coding the instrument cluster in 2015MY Sedona (YP). When replacing an instrument cluster, it is required to variant code the replacement cluster with a correct code (see table below) using GDS or KDS.

Trim Level	Instrument Cluster Type P/N	MDPS Equipped	Figure	Variant Code
L and LX	SEGMENT 94003 A9020	No (-)		0C40
EX	OLED 94007 A9040	No (-)		0C40
SX SXL	TFT 94017 A9110	Yes (+)		9E40
		Yes (+) without SCC		1E40
		Yes (+) without LDWS		9C40
		Yes (+) Without SCC and LDWS		1C40