

## Do Idle Learn Correctly at PDI to Avoid A/T DTC P2638

### AFFECTED VEHICLES

2016 Pilot with 9-speed A/T

Do you have a fairly low mileage vehicle in your shop with the MIL on, the Gear Position indicator blinking, and A/T DTC P2638 (torque feedback signal A range/performance)? Chances are the idle learn procedure wasn't done right at PDI.

To fix this problem, reset the PCM with the HDS, then do the idle learn procedure exactly as shown in the service information.