

Reference	SSM72129
Models	Range Rover / L405
Title	Non Start When Pressing Stop / Start Switch
Category	Driveability
Last modified	09-Jan-2015 00:00:00
Symptom	603300 No Start
Content	<u>Model</u> : L405 – LG- Range Rover (All New) 13MY

Issue

When pressing the Start/Stop Switch the vehicle may not start and no ignition activity is shown on the IPK.

Cause

A production error within the Harness supplier has led to various splice joints having either no continuity or high resistance readings.

Action

For the above concern refer to splice S2DB05B and check resistance readings. If incorrect carry out a Harness repair as per the Wiring Harness Repair instructions found within TOPIx (418-02). The Harness supplier revised their process as of 30.10.2014. Intro VIN: LG203548.