


Reference	SSM72146
Models	LR4 / L319
Title	L319 15MY DTC`s including U0415-68,U0421-68, U0241-00
Category	Chassis
Last modified	23-Jan-2015 00:00:00
Symptom	303000 Steering/Handling
Attachments	F16.pdf
Content	<p><u>Issue:</u> On L319, Discovery 4 / LR4 should you see the following various U-codes (including but not limited to) u0415-68 u0421-68 u0416-68 u0241-00 please follow the instructions below.</p> <p><u>Cause:</u> The centre console cooler box is remaining active once the vehicle ignition is switched off. This causes back EMF and raises DTCs as it fails to gain information from other sensors.</p> <p><u>Action:</u> If presented with a car displaying these conditions please do the following: -Switch Cooler box to OFF position. -Clear the DTCs -Remove fuse F16 from behind the glove box (picture attached shows Fuse box layout) -Cycle ignition -Confirm fault has not re-occurred.</p> <p>JLR is in the process of releasing updated software that will allow the use of the cooler box without causing any errors. This will be released through TOPIx when available.</p>

Fuse 16P
Cooler Box

196.0

70.0

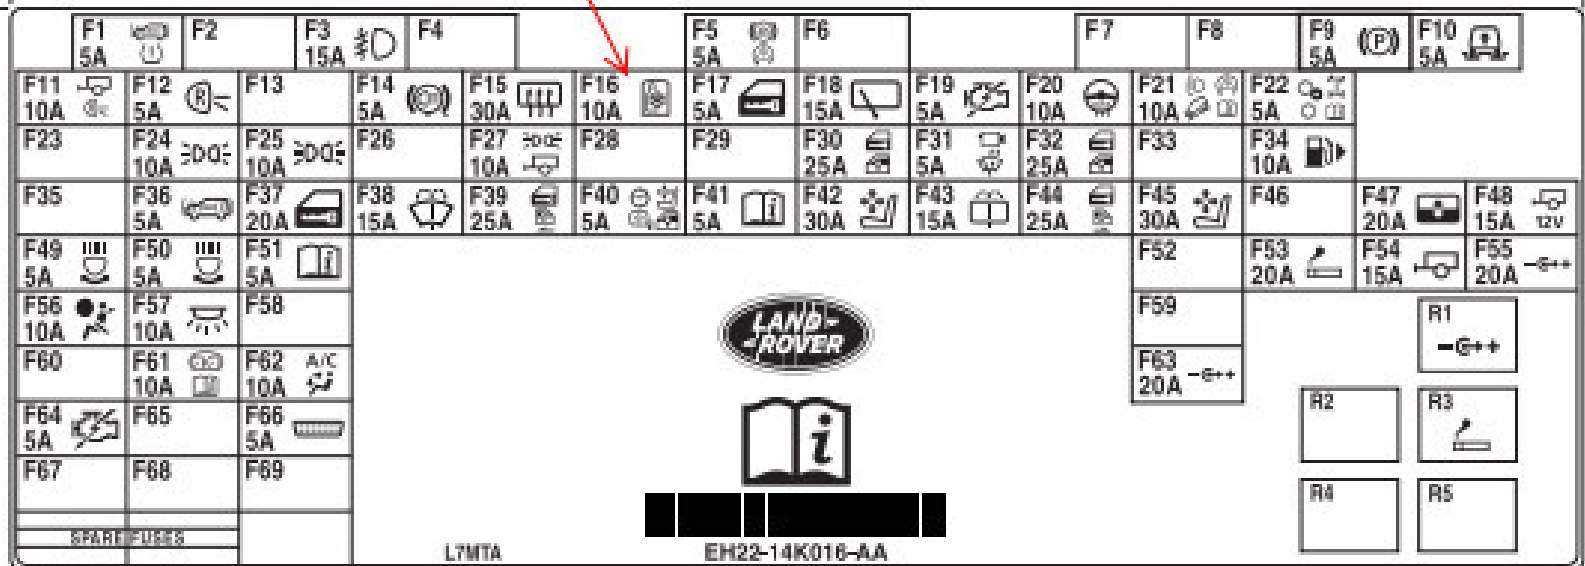

2.0 RAD x 4