

Reference	SSM72164
Models	Range Rover Evoque / L538
Title	9hp transmission. P0795, P07E3, P0893 faults
Category	Driveline
Last modified	29-Jan-2015 00:00:00
Symptom	504000 Other Automatic Transmission Concerns
Content	<p><u>Issue:</u> A small volume of 14 and 15 model year Evoque (L538) vehicles are flagging the following DTC codes, which all relate to the 9HP48 automatic transmission:</p> <ul style="list-style-type: none">• P0795-04• P07E3-07• P0893-07 <p><u>Cause:</u> Internal transmission diagnostics have been triggered – issues now resolved.</p> <p><u>Action:</u> Update the Transmission Control Module (TCM) software to the latest available version. **Please make sure SDD is currently running DVD139 P15 or later.** Once updated, re-test the vehicles and if the DTC does not occur again release to customer. If DTC captured again, please follow standard diagnosis procedures and refer to TOPIx instructions.</p>