

Reference	SSM72165
Models	Discovery Sport / L550
Title	Heating system erratic operation (B1087-54)
Category	Electrical
Last modified	30-Jan-2015 00:00:00
Symptom	208000 Climate Control
Content	<p>: Issue: The Heating system is erratic in its operation</p> <p>Cause: Lost Calibration/Missing Message, B1087-54 Flagged</p> <p>Action:</p> <ol style="list-style-type: none">1. Confirm heating system is not operating as directed by the user.2. Connect SDD and read DTC's3. B1087-54 Flagged. (Lost calibraion, missing message)4. Navigate to recommendations5. Run End stop detection routine6. Test functionality