

TECHNICAL BULLETIN  
LTB00744NAS1  
23 FEB 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**SECTION: 307-01**

**Rattling/Vibrating Noise From Underneath The Vehicle When Driving On An Uneven Road Surface**

**AFFECTED VEHICLE RANGE:**

**LR4 (LA)**

**Model Year:** 2010 Onwards

**VIN:** AA510178 Onwards

**Range Rover (LG)**

**Model Year:** 2013 Onwards

**VIN:** DA000001 Onwards

**Range Rover Sport (LW)**

**Model Year:** 2014 Onwards

**VIN:** EA001207 Onwards

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** A rattling/vibrating noise from underneath the vehicle when driving on an uneven road surface may be evident.

**Cause:** This may be caused by a cracked transmission heat shield mounting bracket.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

**PARTS:**

LR073535                      Transmission heat shield mounting bracket                      Quantity: 1

**WARRANTY:**

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Transmission heat shield mounting bracket - Renew	05.10.40	0.4	01	LR057208

 **NOTE: Normal Warranty procedures apply.**

**SERVICE INSTRUCTION:**




**NOTE:** Some variation in the illustrations may occur, but the essential information is always correct.

1.  **WARNING:** Do not work on or under a vehicle supported only by a jack. Always support the vehicle on safety stands.

Raise and support the vehicle.

2. Remove and discard the transmission heat shield mounting bracket.

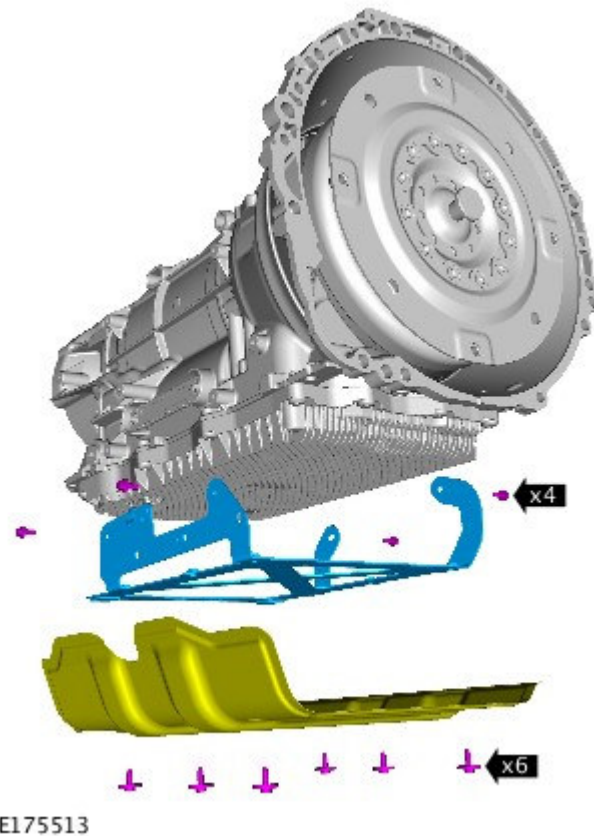

3. Install the new transmission heat shield mounting bracket.

- Torque: 9 Nm

4. Lower the vehicle.