

TECHNICAL BULLETIN
LTB00773NAS1
19 MAY 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-00

Hood Finisher-To-Hood Clash

AFFECTED VEHICLE RANGE:

Range Rover (LG)

Model Year: 2013 Onwards

VIN: DA100000 Onwards

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The hood paint may have been 'erased' away by the hood finisher.

Cause: This may be caused by a difference between the hood and hood finisher tolerances causing a clash condition..

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

LR076042

Hood finisher tape kit

Quantity: 1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:

 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Hood finisher - Renew	76.43.27	0.3	07	LR052722
Local repair and respray	79.B.AA3	0.6	07	LR052722

 **NOTE: Normal Warranty procedures apply.**

SERVICE INSTRUCTION:

1. Check the areas shown for damage.