

Reference	SSM72149
Models	LR4 / L319 Range Rover / L322 Range Rover / L405 Range Rover Sport / L320 Range Rover Sport / L494
Title	VCT solenoid does not fit the vehicle harness – 3L AJ126 and 5L AJ133
Category	Driveability
Last modified	27-May-2015 00:00:00
Symptom	608000 Runs Rough
Attachments	112.pdf
Content	<p>Issue: A new VCT solenoid has been fitted to a 3.0L AJ126 or 5.0L AJ133 engine which requires a link harness in order to be installed on vehicles built with the prior part.</p> <p>Cause: The VCT solenoid design changed, and the electrical connector on the VCT solenoid is a different size.</p> <p>Action: A link harness is available, part number LR061705, to join the existing vehicle harness to the new VCT solenoid connector. Please refer to attachment 1.pdf</p> <ul style="list-style-type: none">• If the VCT solenoid to be replaced looks like part 'A' then a link harness is not needed.• If the part to be replaced looks like part 'B' please also order a link harness.



A

B