Reference	SSM72301
Models	Discovery Sport / L550 (518432 $\rightarrow$ 500429)
Title	Second Row Seat Squeaks & Rattles
Category	Body
Last modified	11-Jun-2015 00:00:00
Symptom	101000 Seating
Content	Issue: A squeak or rattle noise may be heard coming from the second row seat area.

Cause: This may be caused by the second row seat frame to body mounting bolts only being tightened to the minimum specified limit and require lubrication of the seat track locating pins and additional tightening of the mounting bolts to prevent a noise concern.

Action: Should a customer have a concern, locate the second row seat track front locating pins (second hole from front of seat track). Spray PTFE lubricant in to the hole to lubricate the alignment pin. Tighten the two seat track front mounting bolts to 50 Nm. Slide the seat forward and tighten the inboard seat track rear mounting bolt to 50 Nm. Repeat the procedure for the other second row seat assembly.