

TECHNICAL BULLETIN  
LTB00367NAS5  
08 APR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions.**

Changes are highlighted in gray

**SECTION: 418-02**

Surround Camera System Coax Harness Overlay Installation

**AFFECTED VEHICLE RANGE:**

**LR4 (LA)**

**Model Year:** 2010-2013

**VIN:** AA510742-DA699715

**Range Rover Sport (LS)**

**Model Year:** 2010-2013

**VIN:** AA212147-DA814822

**Range Rover (LM)**

**Model Year:** 2010-2012

**VIN:** AA304426-CA393639

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** On vehicles fitted with the Surround Camera System (**not** vehicles fitted with only a Parking Aid - Rear view camera), the camera image may be lost and a blue screen is displayed.

**Cause:** This may be caused by signal loss from poor connections, harness routing and excessive bending, the harness being tightly clamped, and damage to the insulation.



**NOTE: for image loss / blue screen concerns, the Repair Procedure outlined in Technical Bulletin LTB00430 must be completed prior to undertaking a coax harness overlay installation. Only for those concerns not covered by or not rectified after completing LTB00430 should the installation of a coax harness overlay be performed.**

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

**PARTS:**

|          |  |             |
|----------|--|-------------|
| LR025337 | Harness - Interconnect-to-Touch Screen - Cabin (C1184 to C2826) - LR4 ONLY | Quantity: 1 |
| LR025522 | Harness - RH door camera - Door (C3351 to C3504) - LR4 ONLY                | Quantity: 1 |
| LR025524 | Harness - LH door camera - Door (C3353 to C3503) - LR4 ONLY                | Quantity: 1 |
| LR025531 | Harness - Rear camera - Tailgate - LR4 ONLY                                | Quantity: 1 |