

TECHNICAL BULLETIN  
LTB00671NAS3  
08 APR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

**This reissue replaces all previous versions. Please destroy all previous versions.**

Changes are highlighted in gray

**SECTION: 303-14B**

Engine MIL Illuminated With DTC P0042, P0043, P0044, P0055, P0061, P0062, P0063, P0142, P0143, P0144, P0147, P0162, P0163, P0164, and/or P0167 Stored

**AFFECTED VEHICLE RANGE:**

**LR4 (LA)**

**Model Year:** 2014

**VIN:** EA679426-EA731296

**Range Rover Sport (LW)**

**Model Year:** 2014

**VIN:** EA000002-EA399999

**Engine:** V6 S/C 3.0L Petrol

**Range Rover Sport (LW)**

**Model Year:** 2014

**VIN:** EA500005-EA504507

**Engine:** V6 S/C 3.0L Petrol

**Range Rover Sport (LW)**

**Model Year:** 2014

**VIN:** EA600009-EA601762

**Engine:** V6 S/C 3.0L Petrol

**Range Rover (LG)**

**Model Year:** 2014

**VIN:** EA110440-EA197041

**Engine:** V6 S/C 3.0L Petrol

**MARKETS:**

NAS

**CONDITION SUMMARY:**

**Situation:** The engine Malfunction Indicator Lamp (MIL) may be illuminated and Diagnostic Trouble Code (DTC) P0042, P0043, P0044, P0055, P0061, P0062, P0063, P0142, P0143, P0144, P0147, P0162, P0163, P0164, and/or P0167 - relevant to the post-catalyst heated oxygen sensors - may be stored in the Engine Control Module (ECM).

**Cause:** This may be caused by thermal shock when water contacts the heated sensing element.

**Action:** Should a customer express this concern, follow the Service Instruction outlined below.

**PARTS:**

LR035748	Heated oxygen sensor - Post-catalyst - Range Rover Sport (L494), Range Rover (L405)	Quantity: 1 or 2 (as required)
LR052425	Heated oxygen sensor - Post-catalyst - Left-hand - LR4 (L319)	Quantity: 1 (as required)