# TECHNICAL BULLETIN LTB00699NAS2 08 APR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

This reissue replaces all previous versions. Please destroy all previous versions.

Changes are highlighted in gray

#### <u>SECTION: 501-03</u>

Rear Door Soft Close Feature Inoperative

# **AFFECTED VEHICLE RANGE:**

Range Rover (LG)
Model Year: 2013-2014

**VIN:** DA001204-EA180780

# **MARKETS:**

NAS

## **CONDITION SUMMARY:**

Situation: The rear door soft close feature may be inoperative.

Cause: This may be caused by insufficient back pressure from door sealing system.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

#### PARTS:

LR066092	Plunger collar - Non-tapered	Quantity: 2
LR066091	Plunger collar - Tapered	Quantity: 2
LR066080	Plunger spring	Quantity: 2
LR066088	Clear patch - Left	Quantity: 1
LR066087	Clear patch - Right	Quantity: 1
LR066376	Fixing screw	Quantity: 2

#### TOOLS:

NOTE: aluminum-only or new, previously unused, drill bits must be used.

4.2mm aluminum-only drill bit 13mm aluminum-only drill bit

#### **WARRANTY:**

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.