

TECHNICAL BULLETIN
 LTB00733NAS1
 08 APR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-17

Roof Opening Panel Motor Modification for 2005-2009MY Vehicles

AFFECTED VEHICLE RANGE:

Range Rover (LM)

Model Year: 2005-2009

VIN: 5A180214-9A304425

MARKETS:

NAS

CONDITION SUMMARY:

Situation: The roof opening panel motor may not operate. Service part EGQ000010 uses a motor that at 2010 model year was changed to a Webasto motor (along with further harness changes). The supersession is not backwards compatible and the original part is no longer available to order.

Cause: This may be caused by a faulty roof opening panel motor.

Action: Should a customer express this concern, follow the Service Instruction outlined below which details how to install a Webasto roof opening panel motor to an earlier roof opening panel assembly using the link lead kit.

PARTS:

LR067393 Roof opening panel motor and link lead kit Quantity: 1

TOOLS:

Refer to Workshop Manual for any required special tools.

WARRANTY:


 **NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.**

 **NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.**

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Motor - roof opening panel - Front - Renew	76.84.07	0.2	42	EGQ000010
Installation of electrical wiring link lead	86.71.89.55	0.3	42	EGQ000010

 **NOTE: Normal Warranty procedures apply.**

SERVICE INSTRUCTION:

 **CAUTION: installation of the electrical link lead should be carried out using the appropriate tools, crimps and heat shrink from the electrical harness repair kit.**