

TECHNICAL BULLETIN
LTB00746NAS1
22 APR 2015



© Jaguar Land Rover North America, LLC

NOTE: The information in Technical Bulletins is intended for use by trained, professional Technicians with the knowledge, tools, and equipment required to do the job properly and safely. It informs these Technicians of conditions that may occur on some vehicles, or provides information that could assist in proper vehicle service. The procedures should not be performed by 'do-it-yourselfers'. If you are not a Retailer, do not assume that a condition described affects your vehicle. Contact an authorized Land Rover service facility to determine whether this bulletin applies to a specific vehicle.

SECTION: 501-10

'Creak' Noise From Front Seat Frame

AFFECTED VEHICLE RANGE:

Range Rover Evoque (LV)

Model Year: 2012 Onwards

VIN: CH000001 Onwards

MARKETS:

NAS

CONDITION SUMMARY:

Situation: A 'creak' noise from the front seat may be evident.

Cause: This may be caused by metal-to-metal contact between the seat suspension mat hooks and the seat frame arm. This may be verified by visual inspection of seat support mat location hole wear.

Action: Should a customer express this concern, follow the Service Instruction outlined below.

PARTS:

LR072505	Bush suspension mat	Quantity: 4
LR026575	Seat bolts	Quantity: 4

TOOLS:

No Tools Required

WARRANTY:

NOTE: Repair procedures are under constant review, and therefore times are subject to change; those quoted here must be taken as guidance only. Always refer to TOPIx to obtain the latest repair time.

NOTE: DDW requires the use of causal part numbers. Labor only claims must show the causal part number with a quantity of zero.

DESCRIPTION	SRO	TIME (HOURS)	CONDITION CODE	CAUSAL PART
Front seat - Remove for access & refit	78.10.44.99	0.2	01	LR027165
Install four (4) front seat suspension mat bushes	05.10.20	0.2	01	LR027165

NOTE: Normal Warranty procedures apply.

SERVICE INSTRUCTION: