



Service Bulletin

TECHNICAL

Subject: Driver/Passenger Door and/or IP Accent Lighting – Light Bar (Pipe) Inoperative or Loses Intensity

Models: 2010-2015 Chevrolet Camaro
Equipped with Light Piped Door Trim (RPO FCR)

Attention: The lighting does not carry on to or across the instrument panel. This Bulletin also applies to any of the above models that may be Export vehicles.


This Bulletin has been revised to add the 2015 Model Year. Please discard Corporate Bulletin Number 09-08-42-005D.

Condition

Some customers may comment that the accent lighting on the door trim panel loses intensity and does not carry on across to the instrument panel.

Cause


Note: The lighting does not carry on to or across the instrument panel.

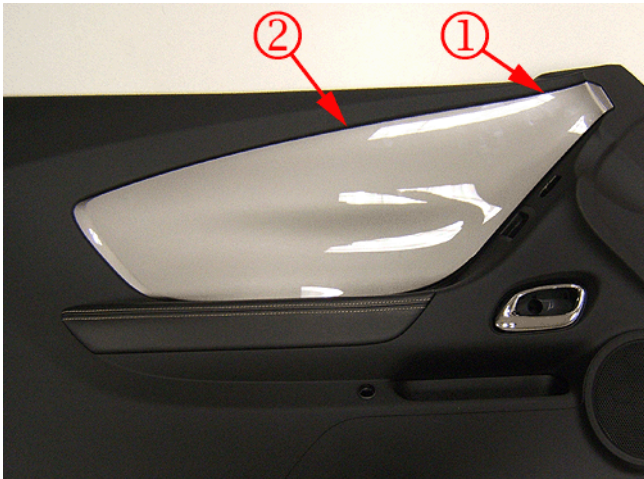

The normal operation of the door accent lighting is the light will be brightest at the rear of the door panel and gradually lose intensity until approximately 76mm (3in) (1) from the front edge of the trim panel. The lighting does not carry on to or across the instrument panel. If the light stops at the center of the door (2), proceed with this bulletin.

Correction

Important: Do not replace the door trim panel to correct illumination concerns.

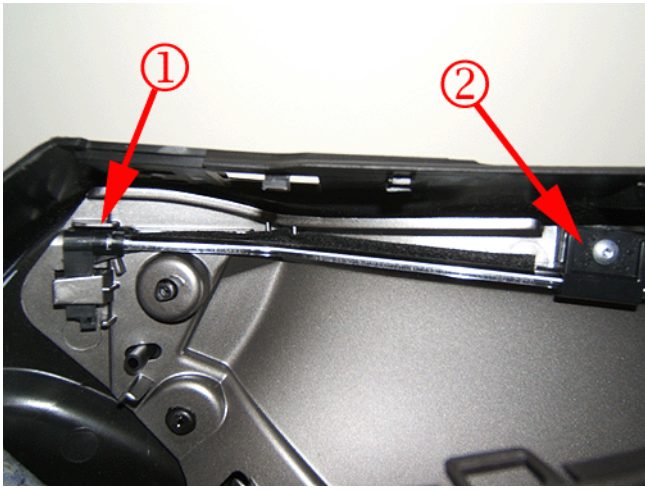

If the light stops at the center of the door, remove the trim panel and make sure the light bar (pipe):

1. Is in the channel
2. Has not dipped down
3. Is properly retained by the retaining clips (2)
4. End cap (1) is properly installed

To verify normal operation, apply 12 volts to the connector and make sure the light is brightest at the rear of the panel and gradually dims towards the front of the door panel.

If the light bar (pipe) is not illuminated the full length, is noticeably different from side to side or inoperative, replace the lamp-harness assembly. There are two different part numbers based on the illumination color of the lamp.

Parts Information

Part Number	Description
92228416	Lamp – Front Side Door Map Pkt Illum (Orange)
92238395	Lamp – Front Side Door Map Pkt Illum (Silver)

Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
2080048*	Door Accent Lighting Check	0.4♦hr
Add	To Check Other Door	0.3♦hr
Add	To Replace One Lamp Assembly	0.1♦hr
*This is a unique Labor Operation for Bulletin use only. It will not be published in the Labor Time Guide.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION