



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Sunroof or Sunshade Inoperative, DTC U151B Set

**Models:** 2010-2015 Buick LaCrosse  
2011-2015 Buick Regal  
2012-2015 Buick Verano  
2011-2015 Chevrolet Cruze  
2012-2015 Chevrolet Malibu  
2015 Chevrolet Impala  
Equipped with Sunroof (RPO C3U or CF5)

**Attention:** This PI includes information learned from Engineering Information Bulletin Number PIE0325A. This PI also applies to any of the above models that may be Export vehicles.

### Condition/Concern

Some customers may comment that the sunroof or sunshade is inoperative when the sunroof switch is pressed.

When checking for DTCs, the BCM may report U151B current or in history.

### Recommendation/Instructions

Engineering is aware of this condition and working on a software calibration change. Once a solution becomes available, this PI will be updated. In the meantime, the technician can complete the following procedure to resolve the concern.

1. If the BCM is confirmed to be reporting DTC U151B, remove the sunroof fuse for 10 seconds.
2. Install the sunroof fuse.
3. Using the first detent on the sunroof glass switch (manual mode), open the sunroof glass fully.  
**Note:** Do not use the express open position of the switch.
4. Using the first detent on the sunroof glass switch (manual mode), close the sunroof glass fully.  
**Note:** Do not use the express close position of the switch.
5. If equipped, using the first detent on the sunroof sunshade switch (manual mode), open the sunroof sunshade fully.  
**Note:** Do not use the express close position of the switch.
6. If equipped, using the first detent on the sunroof sunshade switch (manual mode), close the sunroof sunshade fully.  
**Note:** Do not use the express close position of the switch.
7. Verify that the sunroof glass and sunshade (if equipped) now functions properly.

### Warranty Information

For vehicles repaired under the Bumper-to-Bumper coverage (Canada Base Warranty coverage), use the following labor operation. Reference the Applicable Warranties section of Investigate Vehicle History (IVH) for coverage information.

Labor Operation	Description	Labor Time
4069929	Reset Sunroof - Remove Fuse	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION