



Service Bulletin

PRELIMINARY INFORMATION

Subject: Information on Front Engine Mount Service Recommendation


Models: 2008-2015 Buick Enclave
2009-2015 Chevrolet Traverse
2007-2015 GMC Acadia
2007-2010 Saturn OUTLOOK

Attention: This PI also applies to any of the above models that may be Export vehicles.

Condition/Concern

During normal operation of the vehicle where frequent hot ambient temperatures are experienced, the heat generated from the powertrain may be transferred into the front engine mount from the mount bracket and may weaken the rubber material in the mount.

Recommendation/Instructions

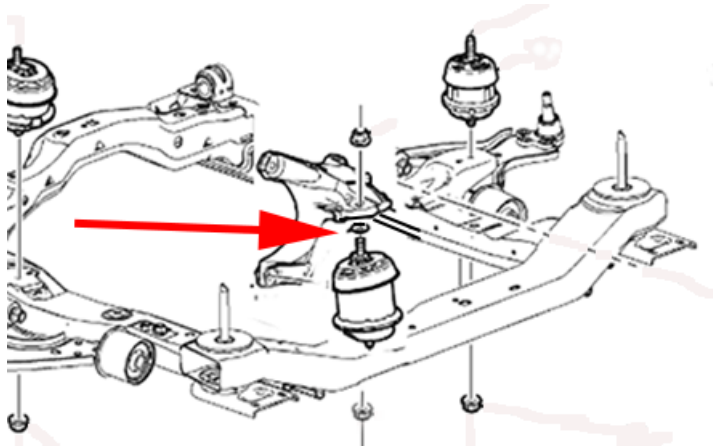

In addition to replacing the front engine mount nuts, General Motors recommends the installation of a newly released washer, P/N 22925178, underneath the front engine mount bracket, on top of the engine mount as illustrated above. This service recommendation will help prevent the weakening of the rubber material in the mount by reducing the transfer of the excessive heat.

Parts Information

Part Number	Description	QTY
22925178	SPACER, ENG FRT MT	1

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that

your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION