



Service Bulletin

PRELIMINARY INFORMATION

Subject: Diagnostic Tips for Airbag Readiness Light On, DTC B101D SYM 00 and C0186, C0196 and/or C0287 Set

Models: 2014-2015 Buick Regal
2015 Chevrolet Malibu Built After June 30, 2014
2015 Chevrolet Sonic

Attention: This PI also applies to any of the above models that may be Export vehicles.

Condition/Concern

A customer or technician may comment that intermittently the Airbag Readiness Light is ON.

Upon further diagnosis, the technician may find DTC B101D SYM 00 and one or more of the following codes (C0186, C0196 and/or C0287) are also set in the SDM (K36 Inflatable Restraint Sensing and Diagnostic Module).

Recommendation/Instructions

Access the Service Programming System (SPS) to check the K36 Inflatable Restraint Sensing and Diagnostic Module (SDM) for the latest software version.

- If the software version currently in the SDM is prior to part# 13596603, install the updated software.
- If the software version is part# 13596603 or newer, follow normal DTC diagnostics in SI.

Labor Operation	Description	Labor Time
2810525	Inflatable Restraint Sensing and Diagnostic Module Reprogramming with SPS	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION