



Service Bulletin

PRELIMINARY INFORMATION

Subject: Windshield Wipers Intermittently Inoperative

Models: 2013 Cadillac ATS

Attention: This PI also applies to any of the above models that may be Export vehicles.

Condition/Concern

Some customers may comment that the windshield wipers are intermittently inoperative in all modes.

This may be caused by high resistance, or an open at ground G105 due to a faulty eyelet.

Recommendation/Instructions

The crimp at the eyelet at ground G105 circuit 750 should be checked for high resistance or for being open intermittently by performing a wiggle test. A visual inspection of the eyelet and shrink wrap will not reveal an issue.

If replacement is needed, select the straight 6 mm ring terminal (P/N 02984712) from tray 1 of the J-38125 Terminal Repair Kit.

Replace the eyelet following published repair procedures.

Warranty Information

For vehicles repaired under warranty, use;

Labor Operation	Description	Labor Time
5430962	Ground Connection Repair	Use Published Labor Operation Time

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION