



Service Bulletin

PRELIMINARY INFORMATION

Subject: Active Rev Matching Inoperative

Models: 2015 Chevrolet Corvette
with manual transmission RPO MEL

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some customers may comment that the Active Rev Matching feature is inoperative and upon further inspection technician may find a P0731 stored in the engine control module.

Recommendation/Instructions

If you should encounter this condition verify that the vehicle is a 2015 equipped with a MEL RPO transmission.

Ask our customer if they noticed this concern to happen after reverse operation, if yes then, no further repairs should be performed.

Clear the DTC and return the vehicle to the customer, please advise the customer that extended reverse operation may falsely set this code.

The current ECM calibration can allow this code to falsely set in reverse as the reverse and first gear ratios are real close numerically. Engineering is currently working on a correction for this concern.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION