



Service Bulletin

PRELIMINARY INFORMATION

Subject: Appearance Of Transmission Fluid Leak On Crossmember

Models: 2015 Chevrolet Colorado
2015 GMC Canyon
With manual transmission RPO N8D built prior to 01/05/15

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some customers may comment on the appearance of a fluid leak on the cross member under the transmission. Dealers may notice the appearance of fluid on the cross member during PDI.

Recommendation/Instructions

If you encounter a vehicle with signs of fluid on the cross member clean the affected area, check the fluid level of the transmission and add dye to the transmission and operate long enough to mix the dye in with the fluid and reevaluate the transmission for a leak.

If no leak is found it is possible that when the powertrain was installed into the chassis at the assembly plant residual oil from the shipping plug was allowed to drip onto the cross member. Return the vehicle to the customer or lot.

If there are signs of a leak with the tracing dye then repair as needed.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION