



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Low Oil Pressure After An Oil And Filter Change

**Models:** 2014-2015 Chevrolet Silverado  
2015 Chevrolet Suburban, Tahoe  
2014-2015 GMC Sierra  
2015 Yukon Yukon XL  
Engine 4.3L LV3 5.3 L83 6.2 L86

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

Some customers may comment on an SES light P0521 and low oil pressure after an oil and filter change.

### Recommendation/Instructions

If this is encountered and the oil and filter were just changed, inspect the oil filter part number.

The correct part number is PF63 89017525.

The PF48 oil filter will fit, but can cause the oil pressure to go low and DTC P0521 to set.

PF63 part number 89017525 is for the GEN5 V6 and V8.

PF48 is for the GEN4 V8.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION