**Bulletin No.: PIT5375A** 

Date: Apr-2015

STICE TROOP,

# Service Bulletin

# PRELIMINARY INFORMATION

Subject: Service Engine Soon Indicator Lamp Dimly Lit While Engine Is Running

Models: 2014 Chevrolet Silverado 1500

2014 GMC Sierra 1500

2015 Chevrolet Silverado, Suburban, Tahoe models

2015 GMC Sierra, Yukon, Yukon XL excluding Denali models

Equipped with Mid-Level Color IPC (RPO UDD) and Gas Engine

# This PI was superseded to update Recommendation/Instructions. Please discard PIT5375.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

#### Condition/Concern

Some customers may comment that they can see the Service Engine Soon (SES) lamp dimly illuminated while the engine is running.

They may also comment the indicator is not illuminated at all when the ignition is in the off position. There will be no DTCs set and the concern may only be noticed in dark conditions.

This concern will affect vehicles built on or around 8/1/14 through 2/28/15.

### Recommendation/Instructions

Replace IPC using an exchange part ordered after 3/20/15 (stock was purged from exchange center on 3/20/15).

Reference latest version of PIT5306 TAC Part Restriction - Instrument Panel Cluster (IPC) for ordering instructions

# **Warranty Information**

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
3431030	Instrument Cluster Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safety. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

