



Service Bulletin

PRELIMINARY INFORMATION

Subject: Reverse/Dome Lamps And Back Up Camera Inoperative F7DR Fuse Open

Models: 2011-2015 Chevrolet Volt

This PI was superseded to update Title and Recommendation/Instructions. Please discard PIC5602A.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some customer may state that that have one or all of the following concerns

1. Reverse lamps Inoperative
2. Rearview Back Up Camera Inoperative (If Equipped)
3. Dome Lamps Inoperative.
4. The vehicle may set a DTC: B2615 in the BCM.

Recommendation/Instructions

Upon general inspection, you may notice that the F7DR (7.5 A) fuse is open in the right instrument panel fuse box.

After initial inspection, a concern can't be found, please inspect circuit 6815 going to the drivers and passenger's sunvisor.

You may have to drop down the front part of the headliner to perform a proper inspection.

If a wiring concern can't be found, move each sunvisor up and down and front to back and see if the fuse opens. If the fuse opens, replace the affected sunvisor

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION