

# **Service Bulletin**

## PRELIMINARY INFORMATION

#### Subject: Vibration Felt When Turning At Highway Speeds

#### Models: 2015 Chevrolet Colorado

2015 GMC Canyon

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### **Condition/Concern**

A small vibration may be experienced through sweeping turns on highways or interstates that goes away once the roadway is straight.

This vibration is only present while turning at highway speed.

There is a condition called Smooth Road Shake (SRS) and the Power Steering Control Module (PSCM) has a calibration to lessen the effects of SRS This calibration is inhibited when the steering wheel is turned beyond a certain degree at which point the SRS may be felt in the vehicle

#### **Recommendation/Instructions**

#### **Note:** Do NOT replace any parts for this condition.

A revised calibration has been written to widen the amount of degrees from center that the wheel can be turned before inhibiting the SRS correction.

Program the PSCM with the latest files available in TIS2WEB, then verify the repair

If a vibration still exists after the PSCM calibrations have been updated, please continue with published vibration diagnostics.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
2810625	Power Steering Control Module Reprogramming with SPS	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



R WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION