



Service Bulletin

PRELIMINARY INFORMATION

Subject: No Crank No Start Loss of Communication Engine Stall SES MIL DIC Messages

Models: 2015 Chevrolet Colorado
2015 GMC Canyon

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.


Condition/Concern

The technician may find a condition of no crank/start, loss of communication, engine stall or an SES MIL with possible DIC messages.


Recommendation/Instructions

If you experience any of the concerns above, inspect the engine wiring harness in the following locations:

Harness contact with the water pump pulley:

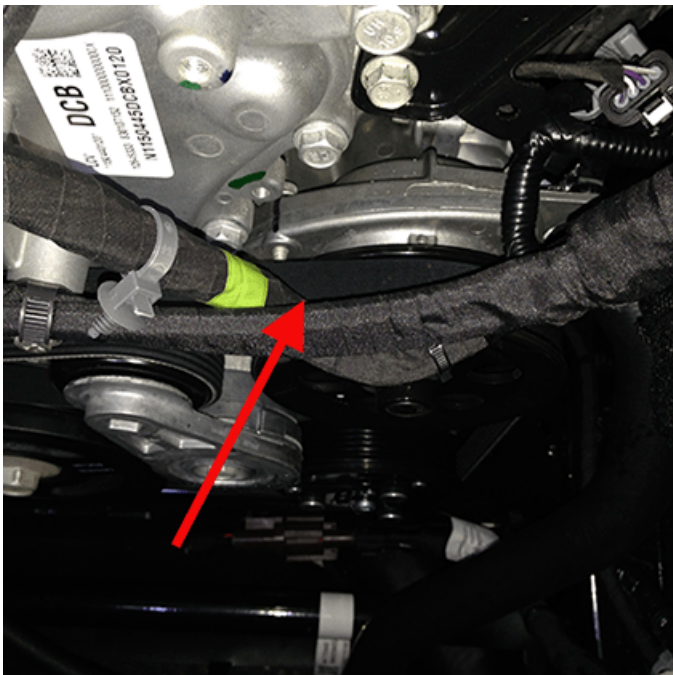

Wiring chafing on the oil filter housing:

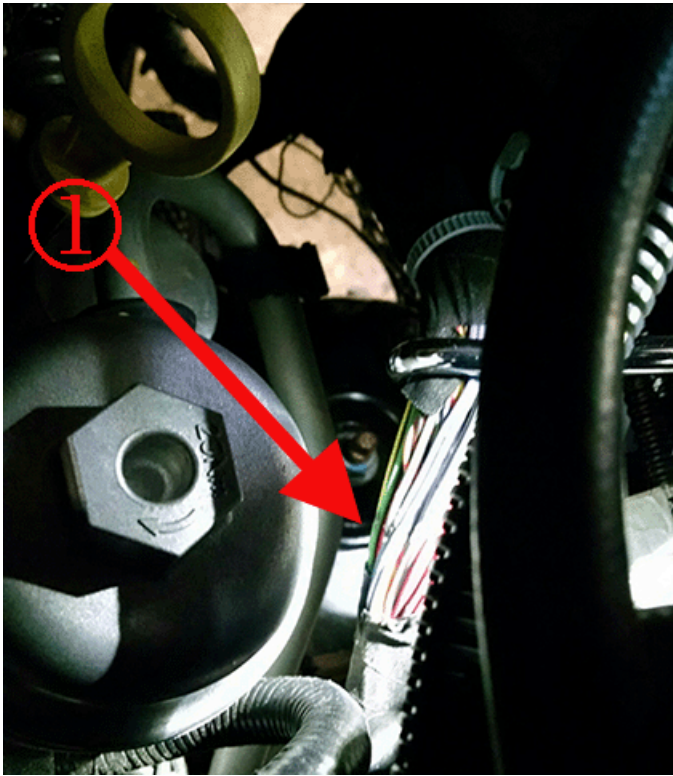

If you encounter either of these scenarios, inspect, repair (as necessary) and route the engine harness away from these possible contact points.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION