



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Water Rush Or Gurgle Noise From Heater Core

**Models:** 2015 Chevrolet Colorado  
2015 GMC Canyon

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

### Condition/Concern

The customer may note a water rush or gurgle type noise from the center dash area.  
The technician may isolate this noise to the heater core caused by air in the cooling system.

### Recommendation/Instructions

If isolated to the heater core, check the system for leaks. Repair any leaks and/ or if no leaks found, add 400 ml coolant to the surge tank.  
Raise the front of the vehicle 1 foot with the surge tank cap off and run the engine for 1 hour.  
Replace the cap and lower the vehicle and recheck for noise.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
* 4080958	Fill Cooling System	0.4 hr
* This is a unique labor operation for bulletin use only. This will not be published in the Labor Time Guide.		

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION