



Service Bulletin

PRELIMINARY INFORMATION

Subject: Intermittent IPC MILs On Interior Lighting Liftgate Inoperative Or LSLAN DTCs

Models: 2010-2015 Chevrolet Equinox
2010-2015 GMC Terrain

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

The customer may state that intermittently the IPC MILs are on, interior lamps are inoperative and / or liftgate inoperative where LSLAN DTCs U0078 U0140 U0151 U0155 U0164 U0198 or U0230 can be present.

There can be an open or shorted terminal connection concern.

Recommendation/Instructions

If the vehicle exhibits this concern, inspect the body harness to chassis harness connector X901 for water intrusion or corrosion. Repair the connector and terminals as required.

This connector is located in the rear of the vehicle, top of the liftgate, behind the glass upper trim panel and just to the left of connector X900.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION