

Service Bulletin

PRELIMINARY INFORMATION

Subject: Diagnostic Tip - Traction And Stability Control Indicator On With Code C0131 Set After BPMV Replacement

- Models: 2012 2015 Chevrolet Sonic
 - 2013 2015 Chevrolet Trax
 - 2013 2015 Buick Encore

This PI was superseded to update models and model years. Please discard PIC5704A

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A technician may run into a scenario where the BPMV (Brake Pressure Modulator Valve) has been replaced and now they have code C0131 set current and there is a Service Traction and/or Stability Control message on in the IPC. During diagnosis the technician may notice that the brake pressure sensor voltage is reading 5 volts at all times with brake pedal released or depressed.

Recommendation/Instructions

Technicians are advised to remove BPMV assembly and inspect the brake pressure sensor assembly and make sure all shipping material has been removed before installation. If shipping material is not removed, this will cause code C0131 to set, and or possibly cause damage to both the EBCM and the BPMV. Please reference the following photo.



Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the

remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION