Bulletin No.: PIT5279C

Date: Oct-2015

PRELIMINARY INFORMATION

Subject: Drivers Power Or Memory Seat and/or Power Adjustable Pedals Inoperative (Inspect For Poor Terminal

Tension)

Models: 2015-2016 Cadillac Escalade Models

2014 Chevrolet Silverado 1500

2015-2016 Chevrolet Silverado, Tahoe, Suburban

2014 GMC Sierra 1500

2015-2016 GMC Sierra and Yukon Models

This PI was superseded to update the Models and Concern section. Please discard PIT5279B.

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

Some owners may comment of the driver's power seat or the memory seat functions are inoperative. Also, if the vehicle is equipped with adjustable pedals they will be inoperative. While performing diagnosis, check terminal tension at the left IP fuse block (X51L) connector X1 terminals 27 and 28, using the correct Diagnostic Test Probe listed in SI.

Note: Terminal 28 at the X1 connector of the left IP fuse block (X51L) is only used on trucks with Adjustable Pedals (RPO JF4) and without Memory (RPO A45).

Recommendation/Instructions

If terminal tension is found to be poor, it will need to be replaced. The terminal is now available as a terminated lead, part number 19301761, which is now available through CCA parts.

Parts Information

Part Number	Description	QTY
19301761	Terminated Lead	As Needed

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

