



Service Bulletin

PRELIMINARY INFORMATION

Subject: Service Power Steering Message Loss of Assist or Loss of Power Multiple U-Codes Stored

Models: 2015 Chevrolet Colorado
2015 GMC Canyon

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

The customer may state there is a service power steering message, loss of power and/or MIL's on in the IPC. The technician may find codes U0073, U0102, U0109 and/or U0140 stored.

Recommendation/Instructions

Inspect terminals for circuits 2500 and 2501 at the TCCM connector, X103 and X106 for oversized or bent terminals. Repair per Service Information if there is an issue found.

Warranty Information

For wiring repairs covered under warranty, please refer to latest version of bulletin 10-00-89-005 for warranty information on wire/connector repairs.

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION