



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Red LED And Current B1447-04 After Performing Canada Upgrade Bulletin 15-08-44-001

**Models:** 2006 Chevrolet Impala  
2006 Chevrolet Monte Carlo

*This PI was superseded to update Recommendation/Instructions and Warranty Information. Please discard PIT5463.*

### Condition/Concern

A technician may notice a red led and current B1447-04 after performing OnStar Canada Upgrade Bulletin 15-08-44-001 and completing the OnStar setup and Activation.

### Recommendation/Instructions

Verify that that there is harness for the OnStar Back Up Battery (BUB) in the vehicle. Install a new BUB in the vehicle. Cycle the ignition, cancel RAP and verify that the B1447-04 is no longer current. Clear the code. Continue with the rest of the upgrade

If there is no harness for the BUB, contact GM Technical Assistance and select the OnStar prompt for further assistance.

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
602058	Onstar Upgrade Repair	.5 hrs

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION