

Bulletin No.: PIP5276D

Date: Jun-2015

PRELIMINARY INFORMATION

Subject: SES Lamp P0521 Setting After An Oil Change And Or Low Oil Pressure Indicated On The Instrument Panel

Models: 2007-2013 Cadillac CTS-V, Escalade

2007-2013 Chevrolet Avalanche, Camaro SS, Colorado, Corvette, Express, Silverado, Suburban, Tahoe

2007-2013 GMC Canyon, Sierra, Savana, Yukon

with a V8 Engine (RPOs L20, L77, L94, L96, L99, L9H, LC8, LC9, LH9, LMF, LMG, LY6, LZ1)

The following diagnosis might be helpful if the vehicle exhibits the symptom(s) described in this PI.

Condition/Concern

A concern of a P0521 Setting After an oil change and or low oil pressure indicated on the instrument panel.

Recommendation/Instructions

If you are working on a Gen4 V8 that is setting a DTC P0521 and or low oil pressure indicated on the instrument panel in cold or hot weather and the engine is currently equipped with a PF48E oil filter, replace with a UPF48R oil filter if one is available.

Note: Only use the UPF48R oil filter if theGen4 V8 is setting a DTC P0521.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
4065530	Oil Filter Replacement	Use Published Labor Operation Time

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.

WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION