



# Service Bulletin

## PRELIMINARY INFORMATION

**Subject:** Service Theft Deterrent Message In DIC Or DTC B2955 Stored

**Models:** 2015 Chevrolet Colorado  
2015 GMC Canyon

*This PI was superseded to update Warranty Information section. Please discard PIT5382C.*

### Condition/Concern

The customer may state that the Service Theft System message is/was on the Driver Information Center (DIC). Upon inspection, the technician may find that DTC B2955 is stored.

### Recommendation/Instructions

Advise to inspect the connections at the immobilizer and ensure there is enough slack in the harness with the column extended. Verify there are no proximity passes or fobs (except GM RKE transmitter) on the key ring, if present, they should be removed. Reprogram the BCM with most recent calibrations

### Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
2810215	Body Control Module Reprogramming with SPS	Use Published Labor Operation Time
* 5480128	Immobilizer Harness Routing And Terminal Inspection	0.2 hr
* This is a unique labor operation for bulletin use only.		

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION