



Bulletin No.: PIC6140A

Date: Nov-2015

Service Bulletin

PRELIMINARY INFORMATION

Subject: Red LED and B2455 After Performing Canada Upgrade Bulletin 15-08-44-001

Models:

- 2005-2009 Buick Allure
- 2004 Buick Century
- 2005-2009 Buick LaCrosse
- 2000-2005 Buick LeSabre
- 2004-2007 Buick Rainier
- 2004 Buick Regal
- 2003-2007 Buick Rendezvous
- 2005-2007 Buick Terraza
- 2003-2007 Cadillac CTS
- 2002-2005 Cadillac Deville
- 2003-2006 Cadillac Escalade
- 2002-2004 Cadillac Seville
- 2004-2006 Cadillac SRX
- 2004-2011 Cadillac STS
- 2004-2009 Cadillac XLR
- 2003-2006 Chevrolet Avalanche
- 2005-2010 Chevrolet Cobalt
- 2004-2012 Chevrolet Colorado
- 2005-2013 Chevrolet Corvette
- 2005-2006 Chevrolet Equinox
- 2004-2005 Chevrolet Express
- 2006-2011 Chevrolet HHR
- 2001-2005 Chevrolet Impala
- 2004-2012 Chevrolet Malibu
- 2002-2005 Chevrolet Monte Carlo
- 2003-2007 Chevrolet Silverado
- 2003-2006 Chevrolet Suburban
- 2003-2006 Chevrolet Tahoe
- 2009-2009 Chevrolet TrailBlazer
- 2005-2009 Chevrolet Uplander
- 2003-2005 Chevrolet Venture
- 2004-2012 GMC Canyon
- 2002-2009 GMC Envoy
- 2003-2005 GMC Savana
- 2003-2007 GMC Sierra
- 2003-2006 GMC Yukon/Yukon XL
- 2003-2007 Hummer H2
- 2006-2011 Hummer H3
- 2001-2003 Oldsmobile Aurora
- 2002-2004 Oldsmobile Bravada
- 2003-2004 Oldsmobile Silhouette
- 2003-2005 Pontiac Aztek
- 2000-2005 Pontiac Bonneville

- 2003-2005 Pontiac Aztek
- 2000-2005 Pontiac Bonneville
- 2007-2010 Pontiac G5
- 2005-2010 Pontiac G6
- 2004-2008 Pontiac Grand Prix
- 2003-2009 Pontiac Montana
- 2005-2006 Pontiac Pursuit
- 2006-2010 Pontiac Solstice
- 2004-2005 Pontiac Sunfire
- 2006 Pontiac Torrent
- 2005-2008 Pontiac Vibe
- 2008-2009 Saturn Astra
- 2007-2010 Saturn Aura
- 2004-2007 Saturn ION
- 2003-2004 Saturn L-Series
- 2005-2007 Saturn Relay
- 2007-2010 Saturn Sky
- 2003-2007 Saturn Vue


This PI was superseded to update Models and Recommendation/Instructions. Please discard PIC6140.




Condition/Concern

A dealer or customer may notice a red LED and DTC B2455 setting current in the VCIM after performing Canada upgrade bulletin 15-08-44-001.

When placing calls or connecting to OnStar, the person on the other end is able to hear the caller clearly.

Recommendation/Instructions

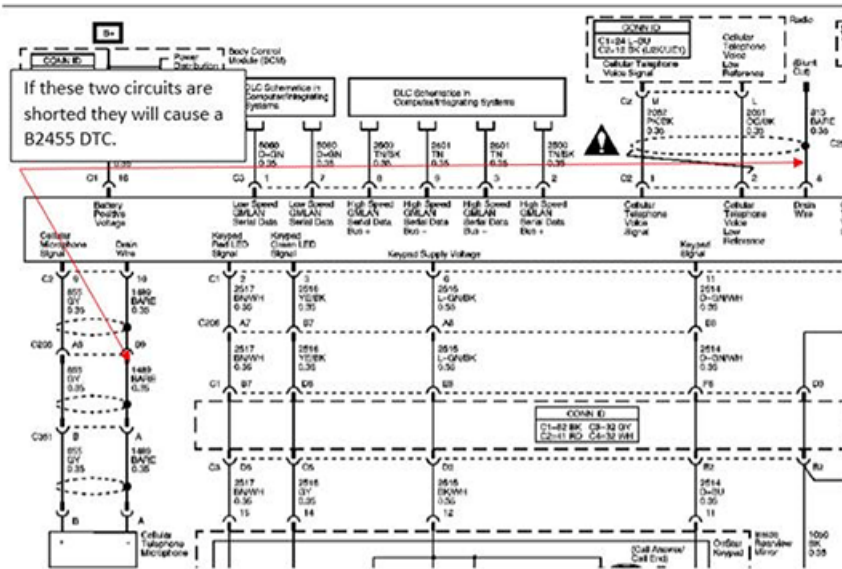

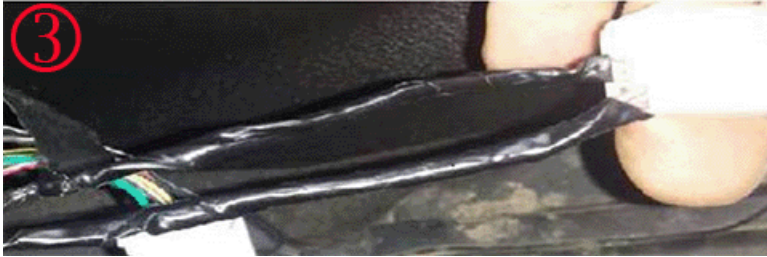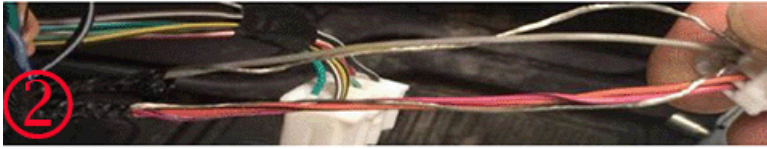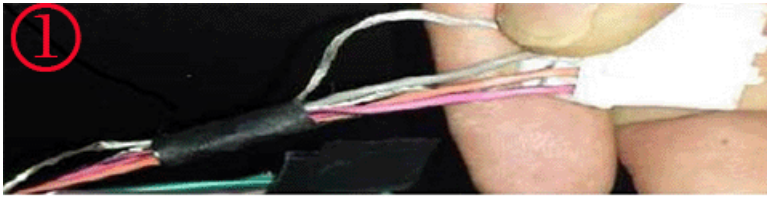

1. It has been found that a short between the audio drain wire and microphone drain wire will cause this concern.
2. Pull back the tape at X2 of the VCIM far enough to see where the bare wires are covered.
3. Tape the bare wires individually to prevent them from shorting. Then tape the harness back up.

Warranty Information

For vehicles repaired under warranty use:

Labor Operation	Description	Labor Time
602058	Onstar Upgrade Wire Repair	.3 Hr

Please follow this diagnostic or repair process thoroughly and complete each step. If the condition exhibited is resolved without completing every step, the remaining steps do not need to be performed.

GM bulletins are intended for use by professional technicians, NOT a "do-it-yourselfer". They are written to inform these technicians of conditions that may occur on some vehicles, or to provide information that could assist in the proper service of a vehicle. Properly trained technicians have the equipment, tools, safety instructions, and know-how to do a job properly and safely. If a condition is described, DO NOT assume that the bulletin applies to your vehicle, or that your vehicle will have that condition. See your GM dealer for information on whether your vehicle may benefit from the information.



WE SUPPORT VOLUNTARY TECHNICIAN CERTIFICATION