



TSB12-002 RevB
06/01/2015

SUBJECT: Vector Retrofit Kits for Battery Cable, Generator Wires and Fuel Hose

This is a re-issue of SER11-029 Rev G. Please work with your customers promptly to get their equipment inspected and, if necessary, repaired.

Carrier Transicold has determined that on the Vector units identified in the serial number ranges listed below the battery cables, generator wires, and fuel hoses could be pinched or rubbed, which may cause potential damage. As a proactive response, Carrier Transicold has developed kits for the battery cable, generator wires and fuel hose which will address this issue. All kits listed below should be installed by your dealership on new installations before delivering a unit to the customer. All other units that have been delivered to the customer should be modified as soon as possible with the following kits:

	Battery Cable	Generator Wires		Fuel Hose
Model	6500/6600MT	1800MT	6500/6600MT	6500/6600MT
R#	R897PTR	R901PTR	R902PTR	R903
Parts/kits	76-00831-00	02-00137-00	02-00137-00	58-00848-21 (qty: 1ft)
Instruction	98-02573	98-50309	98-50309	98-50310
S/N range	Prior to NAN91275393	ALL	Prior to NAN91275258	MAU91175644 to NAN91274679
Labor SRT	Up to .9h	.5h	.5h	.2h

Please contact Carrier Transicold at **800-448-1661** if you have any questions about these modifications. Please take steps to inform your customers of the availability of each of these kits to ensure timely installation can be completed. All labor and parts costs associated with this retrofit will be paid by Carrier Transicold. Modifications must be completed by **December 31, 2015**.

Submit a standard warranty claim and reference the proper reserve number. Add the corresponding labor time in the additional labor field.

Truck/Trailer/Rail Service Engineering
 Athens, GA