

Newmar Corporation Warranty Department

Technical Service Bulletin

Date Issued	Model Year(s) Affected	TSB #
11/09/2015	2010, 2012, 2013	429

Brand

Bay Star Sport	<input type="checkbox"/>	Ventana	<input type="checkbox"/>	Essex	<input type="checkbox"/>
Bay Star	<input type="checkbox"/>	Dutch Star	<input checked="" type="checkbox"/>	King Aire	<input checked="" type="checkbox"/>
Canyon Star	<input type="checkbox"/>	Mountain Aire	<input type="checkbox"/>	Dutch Aire	<input checked="" type="checkbox"/>
Ventana LE	<input type="checkbox"/>	London Aire	<input type="checkbox"/>		

Description

Spartan Motors USA, Inc. (Spartan) has decided that a defect which relates to motor vehicle safety exists in certain 2010, 2012, and 2013 model year motor home chassis.

Newmar has built on these chassis. Attached is the list of specific units. Newmar NHTSA#15v 585, TCA# 2015-404

Please note: This only applies to the Mountain Master and K3 chassis specified by Spartan.

Issue: If the exhaust tube tears, hot exhaust gas could blow against other components or material.

Problem: If exhaust gas temperatures exceed the flash point of other material or components, it could increase the risk of fire. This may occur without warning.

Recommended Action

Correction: Spartan Motors Chassis, Inc. states: a new exhaust tube will be supplied and installed free of charge.

To obtain necessary parts and/or verify recall status, please call 1-800-393-8861 opt 0 and provide the VIN number (last 8 digits) and mileage of the unit.

If you have technical questions, please call Spartan Chassis Customer Product Support Department at 1-800-393-8861.

If further assistance is needed contact, Newmar Dealer Support (866) 290-5371.

NHTSA# 15v 554

Please read this bulletin in its entirety prior to beginning any diagnosis or repairs.



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

Date: October 7, 2015
Re: Newmar Corporation – Motor Vehicle Recall Notification

Subject: Recall Campaign No 15V 585

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the National Traffic and Motor Vehicle Safety Act. Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific Newmar recreational vehicles.

The National Traffic and Motor Vehicle Safety Act requires that each vehicle which is subject to a recall campaign of this type must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not properly repaired within a reasonable time, the owners may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation.

To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall and are instructed to contact Newmar Corporation if you do not remedy the condition within five days of the mutually agreed upon service date. If the condition is not remedied within a reasonable time, they are instructed on how to contact the National Highway Traffic Safety Administration.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific motor homes.

On certain motorhomes, the exhaust tube could tear without warning. If this occurs, hot exhaust gas could blow against other components or materials increasing the risk of fire causing injury and/or damage to property. Correction: Dealers will replace the exhaust tube.

This recall applies to certain Newmar motorhomes built between 5/13/2009 and 5/17/2013.

These motor homes require immediate service. Continued use poses a potential safety hazard.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

REPAIR PROCEDURE

Please contact Spartan Chassis at 1-800-543-4277 opt. 0 for work instructions.

If you should have any questions please contact the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



WHEN YOU KNOW THE DIFFERENCE

NEWMAR CORPORATION

NEWMARCORP.COM

Date: October 7, 2015
Re: Newmar Corporation – Motor Vehicle Recall Notification

Subject: Recall Campaign No.: **2015-404**

This notice is sent to you as a Newmar Dealer in accordance with the requirements of the Canada Motor Vehicle Safety Act. Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific Newmar recreational vehicles.

Each vehicle which is subject to a recall campaign of this type must be satisfactorily repaired within a reasonable time after the owner has tendered it for repair. A failure to adequately repair within 60 days after tender of a vehicle is prima facie evidence of failure to repair within a reasonable time. If the condition is not properly repaired within a reasonable time, the owners may be entitled to an identical or reasonably equivalent vehicle at no charge or to a refund of the purchase price less a reasonable allowance for depreciation.

To avoid providing these problematic solutions, every effort must be made to promptly schedule an appointment with each owner and to repair their vehicle as soon as possible. Vehicle owners are being notified of this recall and are instructed to contact Newmar Corporation if you do not remedy the condition within five days of the mutually agreed upon service date.

REASON FOR THIS RECALL

Newmar Corporation has decided that a defect which relates to motor vehicle safety exists in specific motor homes.

On certain motorhomes, the exhaust tube could tear without warning. If this occurs, hot exhaust gas could blow against other components or materials increasing the risk of fire causing injury and/or damage to property. Correction: Dealers will replace the exhaust tube.

These motor homes require immediate service. Continued use poses a potential safety hazard.

This recall applies to certain Newmar motorhomes built between 6/2/2009 and 5/15/2013.

DEALER CAMPAIGN RESPONSIBILITY

Dealers are to provide to all customers/owner vehicles the service of completing this campaign at no charge to the customer/owner regardless of vehicle age, vehicle mileage, or ownership at the time of repair.

REPAIR PROCEDURE

Please contact Spartan Motors, Inc. at **1-800-543-4277 opt. 0** for work instructions.

If you should have any questions please contact the Newmar service department at: 1-866-290-5371.

Thank you for your cooperation.

Sincerely,

Newmar Corporation



Recall Service Bulletin



DATE: 10-8-15

APPLIES TO: This service bulletin applies to certain MM and K3 models of incomplete motor home chassis built by Spartan Motors USA, Inc. between August 7, 2008 and June 4, 2013.

NHTSA/TC Id: 15V-554

CONDITION: Flexible exhaust tubes may tear

CORRECTION: Replace exhaust tube

LABOR ALLOCATION: 2.0 hrs.

CLASSIFICATION: E3

PARTS NEEDED:

<u>QTY</u>	<u>Part Number</u>	<u>Description</u>
1	S-2503-001	4"X18" long 1712-LL2 replacement

Kit # S-2503-001 Contains:

<u>QTY</u>	<u>Part Number</u>	<u>Description</u>
2	1823-LL2-002	GASKET, EXHAUST, 4.63 OD
2	10028-6	V-CLAMP 4"
1	2924-LL2-001	BELLOWS-4" DIA 18" LONG
1	RSB15-290-001	Instruction Document

<u>QTY</u>	<u>Part Number</u>	<u>Description</u>
1	S-2503-002	5"X18" long 1701-LL2 replacement

Kit # S-2503-002 Contains:

<u>QTY</u>	<u>Part Number</u>	<u>Description</u>
2	1823-LL2-003	GASKET, EXHAUST, ISM/X DP
2	10028-3	GASKET, EXHAUST, 5.0 OD
1	2922-LL2-001	BELLOWS-5" DIA 18" LONG
1	RSB15-290-001	Instruction Document

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.



Recall Service Bulletin



GENERAL INSTRUCTIONS:

Thoroughly review entire service bulletin before starting work. If there are questions or concerns with steps defined in this service bulletin, contact Spartan Motors USA, Inc. Customer & Product Support Group.

All applicable industry safety standards must be followed when performing work identified in this procedure.

STEP-BY-STEP INSTRUCTIONS:

1. Read Tru-Flex installation guidelines found with supplied bellows.
2. If installed, remove heat shields that may limit access to bellows. Retain for reuse.
3. Inspect exhaust bellows for damage.
4. Using a straight edge check for alignment of bellows.
 - a. Alignment should be checked in (2) two quadrants on bellows that are 90° from each other. Ex. Top and Side.



5. The tubes joining bellows must meet the following alignment requirements stated in the installation guidelines. Voids in center of the two tubes are where the bellows are located.
6. Remove bellows and make note on the shape of the bellows that may indicate any misalignment. Refer to FIG. 2-1.

FIG. 2-1



Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.



Recall Service Bulletin



7. After completing alignment checks for the bellows/mating exhaust tubes and exhaust bellows has been removed: If alignment passes checks proceed to **step #9**. If alignment failed checks move to **step #8**.
8. Loosen clamps, support brackets, and v-band clamps that secure tubes to allow for adjustment of the tubes. Refer to 7th digit in VIN number for engine identification. If 7th digit is D, engine is an ISL: refer to FIG. 3-1. If 7th digit is E, engine is an ISX: refer to FIG. 3-2.

ISL installation (shown with bellows as reference)

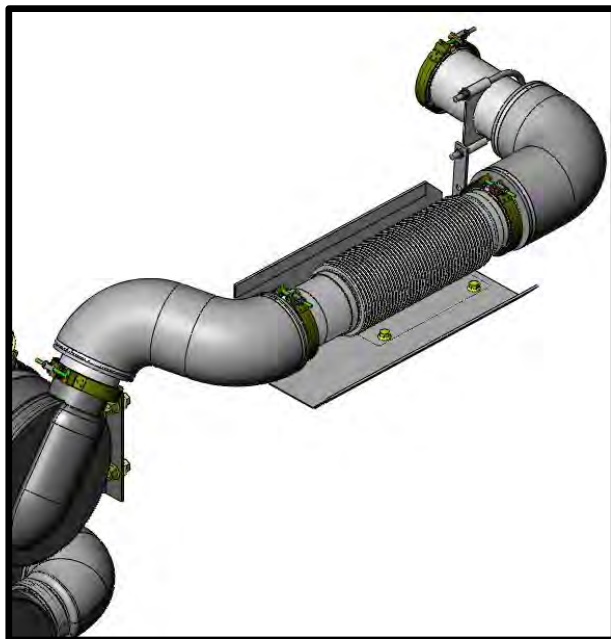


FIG. 3-1

ISX installation (shown with bellows as reference)

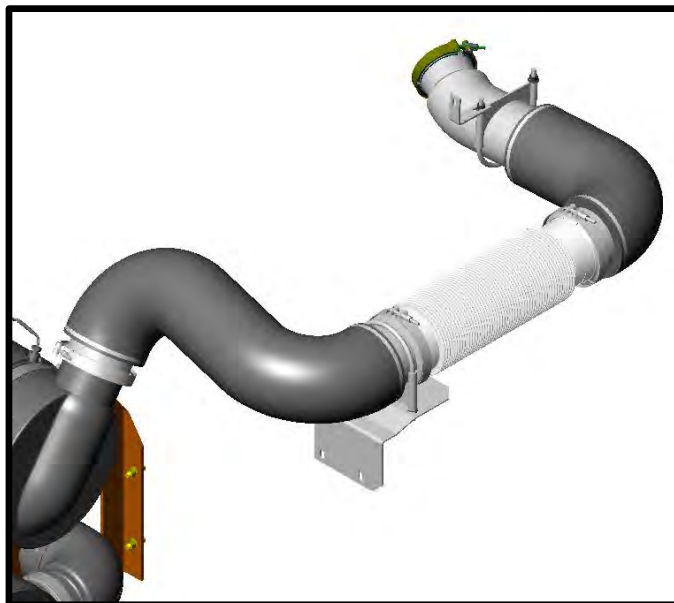


FIG. 3-2

9. Install supplied bellows using supplied v-band clamps and gaskets. Leave clamps loose enough to allow for adjustment if required.
10. Using a straight edge, align tubes and exhaust bellows so they meet requirements for both angularity and lateral offset. The alignment must be checked in (2) two quadrants that are 90° apart. If **step #8** was skipped and proper alignment cannot be achieved **step #8** will need to be completed. Refer to FIG. 4-1.

CAUTION

Alignment of the tubes and bellows are critical.

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.



Recall Service Bulletin

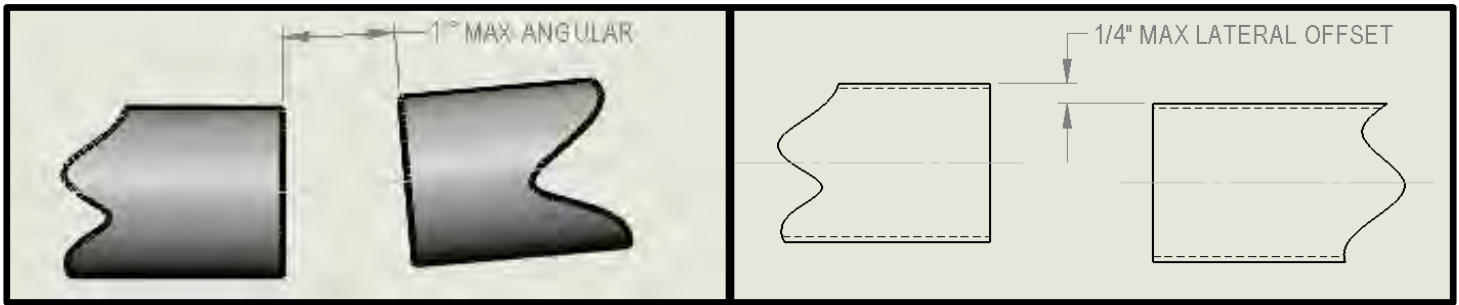


FIG. 4-1

11. Once alignment requirements are met secure all clamps and brackets.
12. Torque (4) v-band clamps to 90 lbs. in.
13. Ensure all other hardware has been tightened.
14. Recheck alignment to ensure no shifting has occurred.
15. Reinstall retained heat shields (if required).

Service Bulletins are intended for use by Professional Technicians only. They are written to guide Professional Technicians in performing service to vehicles of specific nature in conjunction with industry standards. Professional Technicians are appropriately trained on industry standards and have the tools and equipment to perform procedures safely and properly.

VIN Number	Production Number	Model Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
4VZBR1D98AC072804	604263	2010	DS	DP	3623	S	2/3/2010	2/12/2010
4VZBT1D99AC071260	740063	2010	DA	DP	4320	S	5/22/2009	6/2/2009
4VZVU1E94CC074787	530111	2012	KG	DB	4584	S	6/17/2011	6/28/2011
4VZBR1D96AC072929	604206	2010	DS	DP	4010	S	3/1/2010	3/10/2010
4VZBT1D92AC072945	604207	2010	DS	DP	4386	S	3/2/2010	3/11/2010
4VZVU1E9XDC076710	530168	2013	KG	DB	4587	S	12/6/2012	12/14/2012
4VZVU1E90DC075355	530134	2013	KG	DB	4587	S	1/18/2012	1/27/2012
4VZVU1E91DC077292	530199	2013	KG	DB	4584	S	5/7/2013	5/17/2013
4VZVU1E92DC076717	530186	2013	KG	DB	4584	S	1/16/2013	1/23/2013
4VZVU1E94DC076444	530156	2013	KG	DB	4584	S	10/17/2012	10/25/2012
4VZVU1E95DC076128	530148	2013	KG	DB	4584	S	7/12/2012	7/23/2012
4VZVU1E95DC076226	530150	2013	KG	DB	4584	S	8/21/2012	8/30/2012
4VZVU1E95DC077148	530190	2013	KG	DB	4584	S	3/12/2013	3/20/2013
4VZVU1E96DC076686	530167	2013	KG	DB	4584	S	11/20/2012	11/29/2012
4VZVU1E97CC075318	530122	2012	KG	DB	4584	S	11/8/2011	11/16/2011
4VZBT1D9XAC072840	604254	2010	DS	DP	4386	S	2/12/2010	2/23/2010
4VZBT1D90AC072930	604258	2010	DS	DP	4386	S	2/15/2010	2/24/2010
4VZBT1D94AC071859	604221	2010	DS	DP	4386	S	10/12/2009	10/22/2009
4VZBR1D9XAC072805	604257	2010	DS	DP	3623	S	1/27/2010	2/5/2010
4VZBR1D93AC071382	604200	2010	DS	DP	4086	S	7/28/2009	8/10/2009
4VZBR1D97AC072146	604255	2010	DS	DP	4010	S	1/20/2010	1/29/2010
4VZBT1D9XAC072661	604256	2010	DS	DP	4333	S	1/19/2010	1/28/2010
4VZBR1D95AC071433	604202	2010	DS	DP	4086	S	8/5/2009	8/18/2009
4VZBT1D91AC073133	604280	2010	DS	DP	4333	S	4/1/2010	4/13/2010
4VZBT1D92AC071391	604203	2010	DS	DP	4333	S	8/13/2009	8/24/2009
4VZBT1D94AC073157	604281	2010	DS	DP	4333	S	4/5/2010	4/14/2010
4VZVU1E9XCC074745	530102	2012	KG	DB	4584	S	5/26/2011	6/8/2011
4VZVU1E92CC074626	530098	2012	KG	DB	4584	S	4/21/2011	5/4/2011
4VZVU1E95CC075110	530117	2012	KG	DB	4584	S	9/21/2011	10/4/2011
4VZVU1E97DC076227	530151	2013	KG	DB	4584	S	9/4/2012	9/12/2012
4VZVU1E96CC074743	530099	2012	KG	DB	4584	S	5/17/2011	5/26/2011
4VZBT1D95AC071126	740062	2010	DA	DP	4304	S	5/12/2009	5/26/2009
4VZBT1D97AC072830	604266	2010	DS	DP	4333	S	2/17/2010	2/26/2010
4VZVU1E90CC074947	530113	2012	KG	DB	4582	S	8/19/2011	8/31/2011
4VZVU1E94CC074725	530104	2012	KG	DB	4584	S	5/19/2011	6/1/2011
4VZVU1E95CC074815	530108	2012	KG	DB	4584	S	7/19/2011	7/28/2011
4VZBR1D90AC071338	604195	2010	DS	DP	4086	S	7/8/2009	7/21/2009
4VZBT1D90AC069977	604185	2010	DS	DP	4386	S	5/14/2009	5/29/2009
4VZBT1D93AC071299	740068	2010	DA	DP	4317	S	7/7/2009	7/16/2009
4VZBT1D96AC071569	604210	2010	DS	DP	4386	S	9/15/2009	9/28/2009
4VZBR1D92AC072250	604230	2010	DS	DP	4010	S	11/23/2009	12/3/2009
4VZBR1D94AC072105	604231	2010	DS	DP	3625	S	12/11/2009	1/13/2010
4VZBT1D93AC072839	604261	2010	DS	DP	4304	S	2/11/2010	2/22/2010
4VZBT1D98AC071962	604232	2010	DS	DP	4386	S	11/12/2009	11/23/2009
4VZBR1D93AC072838	604264	2010	DS	DP	4084	S	2/5/2010	2/16/2010
4VZBT1D90AC072829	604265	2010	DS	DP	4386	S	2/10/2010	2/19/2010
4VZBR1D93AC072029	604224	2010	DS	DP	3625	S	12/8/2009	12/17/2009
4VZBR1D93AC072662	604253	2010	DS	DP	3625	S	1/25/2010	2/3/2010
4VZBT1D98AC072660	604252	2010	DS	DP	4333	S	1/21/2010	2/1/2010
4VZBT1D99AC072148	604225	2010	DS	DP	4304	S	12/11/2009	1/14/2010
4VZVU1E90CC074768	530109	2012	KG	DB	4584	S	6/10/2011	6/22/2011
4VZVU1E93DC076709	530175	2013	KG	DB	4584	S	11/29/2012	12/6/2012
4VZVU1E95DC075531	530142	2013	KG	DB	4584	S	5/2/2012	5/11/2012
4VZVU1E97CC075139	530118	2012	KG	DB	4582	S	9/16/2011	9/29/2011

VIN Number	Production Number	Model Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
4VZVU1E98CC074677	530105	2012	KG	DB	4584	S	5/4/2011	5/13/2011
4VZBT1D97AC071287	740065	2010	DA	DP	4304	S	6/1/2009	6/9/2009
4VZBR1D9XAC071797	604217	2010	DS	DP	4010	S	10/22/2009	11/2/2009
4VZBT1D90AC071762	604216	2010	DS	DP	4386	S	9/30/2009	10/13/2009
4VZBR1D96AC071327	604193	2010	DS	DP	4055	S	6/22/2009	7/9/2009
4VZBR1D97AC071286	604192	2010	DS	DP	4010	S	6/18/2009	7/8/2009
4VZBT1D99AC072117	604247	2010	DS	DP	4386	S	12/10/2009	1/12/2010
4VZBR1D94AC072573	604251	2010	DS	DP	4043	S	1/28/2010	2/8/2010
4VZBT1D99AC071534	604208	2010	DS	DP	4386	S	9/10/2009	9/22/2009
4VZBT1D91AC071494	740072	2010	DA	DP	4304	S	9/24/2009	10/7/2009
4VZBT1D94AC072011	604228	2010	DS	DP	4304	S	11/20/2009	12/2/2009
4VZBT1D96AC071362	740069	2010	DA	DP	4317	S	7/16/2009	7/29/2009
4VZBT1D96AC071409	740070	2010	DA	DP	4304	S	7/23/2009	8/5/2009
4VZBT1D97AC072147	604229	2010	DS	DP	4386	S	12/10/2009	1/12/2010
4VZBR1D91AC071266	604186	2010	DS	DP	4055	S	5/26/2009	6/3/2009
4VZBR1D95AC072937	604267	2010	DS	DP	4016	S	3/9/2010	3/18/2010
4VZBR1D96AC071568	604212	2010	DS	DP	4086	S	9/17/2009	9/30/2009
4VZBR1D97AC071496	604213	2010	DS	DP	4016	S	9/23/2009	10/6/2009
4VZBT1D9XAC073132	604276	2010	DS	DP	4333	S	3/23/2010	4/6/2010
4VZBT1D90AC071292	740066	2010	DA	DP	4317	S	6/3/2009	6/12/2009
4VZBT1D97AC073069	604272	2010	DS	DP	4333	S	3/8/2010	3/17/2010
4VZBT1D95AC072938	604269	2010	DS	DP	4333	S	2/25/2010	3/8/2010
4VZVU1E96DC076168	530147	2013	KG	DB	4584	S	8/6/2012	8/14/2012
4VZBR1D91AC071025	604182	2010	DS	DP	4084	S	5/18/2009	5/29/2009
4VZBR1D94AC071259	604183	2010	DS	DP	4086	S	5/13/2009	5/29/2009
4VZBR1D94AC072251	604241	2010	DS	DP	4086	S	11/24/2009	12/4/2009
4VZBR1D95AC072145	604246	2010	DS	DP	4084	S	12/7/2009	12/16/2009
4VZBR1D96AC072106	604234	2010	DS	DP	4084	S	11/18/2009	11/30/2009
4VZBR1D98AC072107	604233	2010	DS	DP	4084	S	11/19/2009	12/2/2009
4VZBT1D9XAC072109	604243	2010	DS	DP	4333	S	11/25/2009	12/8/2009
4VZBT1D90AC070353	604181	2010	DS	DP	4386	S	5/19/2009	6/1/2009
4VZBT1D90AC071535	604209	2010	DS	DP	4333	S	9/15/2009	9/28/2009
4VZBT1D90AC071860	604219	2010	DS	DP	4333	S	10/19/2009	10/28/2009
4VZBT1D98AC072108	604242	2010	DS	DP	4333	S	11/24/2009	12/7/2009
4VZBT1D99AC071498	604205	2010	DS	DP	4386	S	8/20/2009	9/10/2009
4VZVU1E9XDC075895	530149	2013	KG	DB	4584	S	7/17/2012	7/26/2012
4VZVU1E9XDC076612	530158	2013	KG	DB	4584	S	10/19/2012	10/29/2012
4VZVU1E90CC075239	530125	2012	KG	DB	4584	S	10/26/2011	11/4/2011
4VZVU1E90CC075645	530141	2012	KG	DB	4584	S	4/17/2012	5/1/2012
4VZVU1E90DC076344	530154	2013	KG	DB	4584	S	10/4/2012	10/12/2012
4VZVU1E90DC076716	530181	2013	KG	DB	4584	S	1/7/2013	1/15/2013
4VZVU1E90DC077249	530193	2013	KG	DB	4584	S	4/5/2013	4/15/2013
4VZVU1E91CC074794	530107	2012	KG	DB	4584	S	7/13/2011	7/22/2011
4VZVU1E91CC075315	530127	2012	KG	DB	4584	S	11/1/2011	11/10/2011
4VZVU1E91DC076613	530161	2013	KG	DB	4584	S	11/1/2012	11/9/2012
4VZVU1E91DC076661	530166	2013	KG	DB	4584	S	11/9/2012	11/19/2012
4VZVU1E92CC074769	530103	2012	KG	DB	4584	S	6/14/2011	6/23/2011
4VZVU1E92CC075226	530121	2012	KG	DB	4584	S	10/14/2011	10/25/2011
4VZVU1E92CC075386	530135	2012	KG	DB	4584	S	1/27/2012	2/7/2012
4VZVU1E92CC075405	530136	2012	KG	DB	4584	S	2/9/2012	2/20/2012
4VZVU1E93CC075610	530139	2012	KG	DB	4584	S	3/5/2012	3/15/2012
4VZVU1E93DC076385	530155	2013	KG	DB	4584	S	10/9/2012	10/17/2012
4VZVU1E93DC076614	530162	2013	KG	DB	4584	S	11/5/2012	11/13/2012
4VZVU1E93DC076662	530174	2013	KG	DB	4584	S	11/14/2012	11/26/2012

VIN Number	Production Number	Model Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
4VZVU1E93DC076712	530178	2013	KG	DB	4584	S	12/5/2012	12/12/2012
4VZVU1E93DC077200	530194	2013	KG	DB	4584	S	3/26/2013	4/4/2013
4VZVU1E94CC074823	530115	2012	KG	DB	4582	S	9/6/2011	9/15/2011
4VZVU1E94CC075227	530123	2012	KG	DB	4584	S	10/24/2011	11/2/2011
4VZVU1E94CC075406	530137	2012	KG	DB	4584	S	2/15/2012	2/24/2012
4VZVU1E94DC076685	530164	2013	KG	DB	4584	S	11/16/2012	11/27/2012
4VZVU1E95CC075267	530129	2012	KG	DB	4584	S	11/9/2011	11/17/2011
4VZVU1E95DC075870	530144	2013	KG	DB	4584	S	5/9/2012	5/21/2012
4VZVU1E95DC076632	530163	2013	KG	DB	4584	S	11/8/2012	11/16/2012
4VZVU1E96CC074578	530100	2012	KG	DB	4584	S	4/11/2011	4/20/2011
4VZVU1E96CC074791	530110	2012	KG	DB	4584	S	6/28/2011	7/18/2011
4VZVU1E96DC076560	530159	2013	KG	DB	4584	S	10/25/2012	11/2/2012
4VZVU1E96DC077045	530184	2013	KG	DB	4584	S	2/4/2013	2/12/2013
4VZVU1E96DC077188	530191	2013	KG	DB	4584	S	4/2/2013	4/9/2013
4VZVU1E97CC075321	530131	2012	KG	DB	4584	S	11/17/2011	11/29/2011
4VZVU1E97DC076731	530187	2013	KG	DB	4584	S	1/21/2013	1/29/2013
4VZVU1E98CC074713	530101	2012	KG	DB	4584	S	5/10/2011	5/20/2011
4VZVU1E98CC074940	530112	2012	KG	DB	4584	S	8/3/2011	8/15/2011
4VZVU1E98DC076589	530157	2013	KG	DB	4584	S	10/30/2012	11/7/2012
4VZVU1E99CC075191	530120	2012	KG	DB	4584	S	10/5/2011	10/14/2011
4VZVU1E99CC075305	530126	2012	KG	DB	4584	S	10/31/2011	11/9/2011
4VZVU1E99CC075353	530128	2012	KG	DB	4584	S	12/1/2011	12/9/2011
4VZVU1E99DC076004	530145	2013	KG	DB	4584	S	6/5/2012	6/13/2012
4VZVU1E99DC076553	530160	2013	KG	DB	4584	S	10/15/2012	10/24/2012
4VZBT1D96AC071894	604223	2010	DS	DP	4304	S	10/27/2009	11/5/2009
4VZBT1D98AC071301	604194	2010	DS	DP	4386	S	6/24/2009	7/14/2009
4VZBR1D90AC072828	604262	2010	DS	DP	4055	S	2/8/2010	2/17/2010
4VZBR1D92AC072605	604259	2010	DS	DP	4086	S	1/29/2010	2/9/2010
4VZBR1D90AC070058	740073	2010	DA	DP	4023	S	10/7/2009	10/20/2009
4VZBR1D95AC072808	740074	2010	DA	DP	4023	S	1/28/2010	2/8/2010
4VZBT1D9XAC072806	604249	2010	DS	DP	4386	S	1/25/2010	2/3/2010
4VZBT1D90AC071390	604201	2010	DS	DP	4386	S	8/4/2009	8/17/2009
4VZBT1D90AC072149	604250	2010	DS	DP	4386	S	1/15/2010	1/26/2010
4VZBT1D91AC071267	604188	2010	DS	DP	4333	S	5/27/2009	6/4/2009
4VZBT1D91AC071270	604187	2010	DS	DP	4386	S	5/27/2009	6/4/2009
4VZBT1D92AC072606	604248	2010	DS	DP	4333	S	1/18/2010	1/27/2010
4VZBT1D93AC071450	740071	2010	DA	DP	4304	S	8/3/2009	8/13/2009
4VZBT1D98AC071265	740064	2010	DA	DP	4317	S	5/28/2009	6/5/2009
4VZBT1D98AC071895	604227	2010	DS	DP	4386	S	11/10/2009	11/19/2009
4VZVU1E90CC073992	530097	2012	KG	DB	4584	S	3/22/2011	3/31/2011
4VZVU1E90CC075354	530132	2012	KG	DB	4584	S	12/16/2011	1/11/2012
4VZVU1E91DC076708	530173	2013	KG	DB	4584	S	11/26/2012	12/3/2012
4VZVU1E91DC076711	530176	2013	KG	DB	4587	S	12/3/2012	12/10/2012
4VZVU1E93DC076631	530171	2013	KG	DB	4584	S	11/13/2012	11/20/2012
4VZVU1E93DC077147	530189	2013	KG	DB	4584	S	2/13/2013	2/21/2013
4VZVU1E94CC075177	530119	2012	KG	DB	4584	S	9/28/2011	10/10/2011
4VZVU1E94DC076038	530143	2013	KG	DB	4582	S	5/16/2012	5/25/2012
4VZVU1E95CC075317	530130	2012	KG	DB	4584	S	11/11/2011	11/22/2011
4VZVU1E95DC076713	530169	2013	KG	DB	4584	S	12/13/2012	12/20/2012
4VZVU1E95DC076730	530185	2013	KG	DB	4584	S	1/14/2013	1/22/2013
4VZVU1E96CC075343	530124	2012	KG	DB	4584	S	11/23/2011	12/5/2011
4VZVU1E97DC075644	530140	2013	KG	DB	4584	S	3/20/2012	4/10/2012
4VZVU1E97DC076714	530179	2013	KG	DB	4588	S	12/19/2012	1/10/2013
4VZVU1E98CC075408	530133	2012	KG	DB	4584	S	2/28/2012	3/8/2012

VIN Number	Production Number	Model Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
4VZVU1E99DC076066	530146	2013	KG	DB	4584	S	6/22/2012	7/12/2012
4VZVU1E99DC076732	530182	2013	KG	DB	4587	S	1/30/2013	2/7/2013
4VZBR1D94AC072010	604237	2010	DS	DP	4016	S	11/17/2009	11/25/2009

Canadian Units

VIN Number	Production Number	Model Year	Brand	Type	Floor Plan	Chassis Brand	Date In Production	Date Off Production
4VZBR1D90AC071761	604214	2010	DS	DP	4086	S	9/30/2009	10/13/2009
4VZBR1D92AC072944	604277	2010	DS	DP	4010	S	3/19/2010	3/31/2010
4VZBR1D93AC072001	604236	2010	DS	DP	4043	S	11/16/2009	11/24/2009
4VZBR1D94AC071858	604220	2010	DS	DP	4086	S	10/19/2009	10/29/2009
4VZBR1D96AC071361	604196	2010	DS	DP	4086	S	7/15/2009	7/27/2009
4VZBR1D96AC071893	604226	2010	DS	DP	4010	S	11/6/2009	11/17/2009
4VZBR1D97AC071434	604199	2010	DS	DP	4055	S	8/12/2009	8/25/2009
4VZBT1D9XAC071655	604211	2010	DS	DP	4386	S	9/21/2009	10/1/2009
4VZBT1D9XAC071798	604218	2010	DS	DP	4304	S	10/1/2009	10/14/2009
4VZBT1D91AC071656	604215	2010	DS	DP	4333	S	9/29/2009	10/12/2009
4VZBT1D91AC072807	604238	2010	DS	DP	4333	S	2/4/2010	2/15/2010
4VZBT1D92AC071293	740067	2010	DA	DP	4304	S	6/8/2009	6/16/2009
4VZBT1D92AC071343	604197	2010	DS	DP	4333	S	7/14/2009	7/23/2009
4VZBT1D93AC071271	604190	2010	DS	DP	4386	S	6/2/2009	6/11/2009
4VZBT1D93AC071383	604198	2010	DS	DP	4333	S	7/22/2009	8/4/2009
4VZBT1D93AC073070	604271	2010	DS	DP	4386	S	3/4/2010	3/15/2010
4VZBT1D94AC072946	604270	2010	DS	DP	4333	S	3/3/2010	3/12/2010
4VZBT1D96AC071300	604191	2010	DS	DP	4333	S	6/8/2009	6/17/2009
4VZBT1D96AC072110	604240	2010	DS	DP	4333	S	12/8/2009	1/11/2010
4VZBT1D97AC071497	604204	2010	DS	DP	4333	S	8/19/2009	9/9/2009
4VZBT1D98AC072030	604235	2010	DS	DP	4386	S	11/12/2009	11/23/2009
4VZVU1E91CC074990	530114	2012	KG	DB	4582	S	9/13/2011	9/22/2011
4VZVU1E92CC074822	530116	2012	KG	DB	4584	S	8/29/2011	9/9/2011
4VZVU1E95DC076176	530152	2013	KG	DB	4588	S	8/14/2012	8/23/2012
4VZVU1E95DC076338	530153	2013	KG	DB	4584	S	9/25/2012	10/8/2012
4VZVU1E96CC075407	530138	2012	KG	DB	4584	S	2/22/2012	3/2/2012
4VZVU1E96DC077255	530180	2013	KG	DB	4588	S	5/6/2013	5/15/2013
4VZVU1E99DC076715	530177	2013	KG	DB	4584	S	1/9/2013	1/17/2013