

# Technical Service Bulletin



## 37 Transmission warning light briefly comes on (DTC P0606)

37 15 54 2030582/5 January 30, 2015. Supersedes Technical Service Bulletin Group 37 number 13-05 dated April 29, 2013 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A4, A5 Cabriolet, A6	2012 - 2013	All	0AW CVT transmission

## Condition

REVISION HISTORY		
Revision	Date	Purpose
5	-	Revised <i>Service</i> (Updated SVM table) Revised <i>Warranty</i> (Updated labor operations)
4	4/29/2013	Revised <i>Warranty</i> (Removed labor operation) Revised title
3	2/26/2013	Revised <i>Warranty</i> (Added labor operation)
2	2/11/2013	Revised <i>Service</i> (Updated SVM table) Revised <i>Warranty</i> (Removed adaptation GFF) Revised header data (Added models)
1	8/20/2012	Original publication

- Customer may report that the transmission warning light comes on. There are no drivability/starting concerns.
- **DTC P060600** (Control Module Malfunctioning, Sporadic) is stored in the transmission control module (TCM), J217 (address word 02).

## Technical Background

The entry is caused by an overly sensitive diagnosis in the transmission control module.

## Production Solution

New software in the TCM addressed the condition.

# Technical Service Bulletin



## Service

If the following conditions apply, update the transmission control module using the SVM Update Instructions that follow. If the following conditions *do not* apply, continue the repair with GFF.

- GFF scan shows fault code **P060600** (Control Module Malfunctioning, Sporadic) stored in the transmission control module.
- The vehicle has an affected software version according to the table below.

Model	Engine and Transmission	Old Software Part Number	Old Software Version	New Software Part Number	New Software Version (or higher)	SVM Code Input
A4, A5 Cabriolet	2.0L with 0AW CVT transmission	8K2927155E	All	8K9927155	0003	02A067
A6 Front Track	2.0L with 0AW CVT transmission	4G1927155G	All	4G2927155	0003	02A067

### SVM Update Instructions

1. Follow all instructions in TSB 2011732: *00 Software Version Management (SVM), operating instructions*.
2. Update the TCM using the SVM action code as listed in the table above if necessary.

# Technical Service Bulletin



## Warranty

<b>Claim Type:</b>	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.		
<b>Service Number:</b>	3730		
<b>Damage Code:</b>	0039		
<b>Labor Operations:</b>	Update TCM software	3730 2599	50 TU
<b>Diagnostic Time:</b>	GFF	No allowance	0 TU
	Road test prior to service procedure	No allowance	0 TU
	Road test after service procedure	No allowance	0 TU
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)		
<b>Claim Comment:</b>	As per TSB #2030582/5		

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

## Additional Information

The following Technical Service Bulletin will be necessary to complete this procedure:

- TSB 2011732 *00 Software Version Management (SVM), operating instructions*.

All part and service references provided in this TSB (2030582) are subject to change and/or removal. Always check with your Parts Dept. and service manuals for the latest information.