

Technical Service Bulletin

57 Comfort closing of side windows with outside door handle lock button inoperative

57 15 06 2039600/1 January 27, 2015.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment
A3	2015	000001 - 078489	Audi advanced key
A3 Cabriolet	2015	000001 - 078443	Audi advanced key

Condition

In vehicles equipped with Audi advanced key:

- The comfort closing feature does not work when the driver's side door handle lock button is used.
- The windows can be closed when the mechanical key is inserted into the driver's side door lock cylinder and held in the lock position.

Technical Background

The onboard supply control unit, J519 (address word 09 – BCM1), has incorrect parameter data from the factory.

Production Solution

Updated parameter data.

Service

- 1. Update the parameter data of the onboard supply control unit, J519 (address word 09 BCM1), with SVM as listed in the table below. The parameter part number and version can only be seen after the SVM code completes.
- To test the newly-activated function, open one or multiple side windows and close all doors. Next, lock the car with the outside door handle button while keeping the button pressed the entire time as the windows are closing.

© 2015 Audi of America, Inc.

Page 1 of 2

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Model	Old Parameter Part Number	Old Parameter Version	New Parameter Part Number	New Parameter Version	SVM Code Input
	8V0909514E		8V0909514E	0073	09A016
10	8V0909514H	A 11	8V0909514H	0074	
A3	8V0909514G/K	All	8V0909514K	0081	
	8V0909514XG		8V0909514XG	0002	
A3 Cabriolet	8V7909514D	All	8V7909514D	0032	09A016

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.					
Service Number:	nber: 9710					
Damage Code:	0039					
Diagnostic Time:	GFF	0150 0000	Time stated on diagnostic protocol (Max 35 TU)			
	Road test prior to service procedure	No allowance	0 TU			
	Road test after service procedure	No allowance	0 TU			
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty	Online for DADP allowa	nce details)			
Claim Comment:	As per TSB #2028772/1					

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

Additional Information

All parts and service references provided in this TSB (2039600) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2015 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.