

A PDF of this newsletter and previous ones can be found by logging in to ServiceNet and clicking on the [Elsa Newsletter](#) section in the Technician References menu.

Audi Truth in Engineering 

Audi Elsa Newsletter

Edition 126: March 9, 2015

Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Technical Bulletins

97 After J519 control module is replaced, "Defective light bulb" warning light illuminates (DTC 01494 and 01498) (2023283/2)

Model(s)	Year	Vehicle Specific Equipment
Q7	2009–2011	Not Applicable
Condition: The following conditions are present after the vehicle electrical system control module, J519, is replaced:		
• A defective light bulb warning appears in the instrument cluster, but the side marker lights are functioning normally. • The following DTCs are stored in the vehicle electrical system control module, J519 (address word 09): ◦ DTC 01494 (Bulb for left parking light-M1) with fault symptom 011 (Open circuit)		

- DTC 01494 (Bulb for right parking light-M3) with fault symptom 011 (Open circuit)

Production Solution: Not applicable.

01 MIL on (DTC P0456) - Repair Authorization (2039888/1)

Model(s)	Year	Vehicle Specific Equipment
Q7	2015	3.0T

Condition:

- MIL on.
- DTC P0456 (very small EVAP leak) stored in engine control module (ECM), J623 (address word 01).
- There is no leak in the EVAP system.

Production Solution: No changes to production have been made, as no issue has been identified.

91 Radio turns on and off or door locks actuate when vehicle is being driven (2019838/7)

Model(s)	Year	Vehicle Specific Equipment
A3	2008-2013	Not Applicable
TT, R8	2008-2015	Not Applicable

Condition:

- Radio turns on and off while vehicle is being driven.
 - Clock in radio sporadically does not work.
- Door locks actuate while vehicle is being driven.

Production Solution: The S-contact is improved with a modified lubricant that has better electrical conductivity and improved viscosity. In addition, 100% microscopic inspection is now in place.

[Back to top](#)

94 Taillight lens delamination or cracks on lower edge (2039906/1)

Model(s)	Year	Vehicle Specific Equipment
TT	2013-2015	Not Applicable
Condition: - The customer states that the taillight lens is cracked or broken in the lower edge of the lens. This is a visual defect complaint. - There is delamination along, or isolated to, the edge area of the taillight lens. The delamination cannot always be felt. - On the affected side, the taillight lens is touching the body (bumper/side panel). There may be visible contact or interference marks caused by the rubbing of the tail light lens to the body. Production Solution: Improved assembly process.		

19 Air bubble noises out of coolant or HVAC system, low heating performance (2039891/1)

Model(s)	Year	Vehicle Specific Equipment
All	2015	3.0 TFSI
Condition: - Heating performance is low. - Air bubble noises are heard from coolant and/or heat exchanger area. Production Solution: Modified parts in production starting with production date 2/5/2015.		

70 Noises from headliner / sunroof area (2038029/2)

Model(s)	Year	Vehicle Specific Equipment
A8, Q7, allroad, Q5	2010-2016	Not Applicable
A3, Q3	2015-2016	Not Applicable
Condition: Various squeaks and/or rattles are heard from the roof area on vehicles equipped with a panoramic sunroof. Production Solution: Not applicable.		

**19 Coolant warning light on, coolant level close to or below minimum
(2039777/2)**

Model(s)	Year	Vehicle Specific Equipment
A3	2015	Not Applicable
Condition: • The coolant temperature warning light is on. • The coolant level in the coolant expansion tank is close to or below minimum. • The customer had to top off the coolant several times. Production Solution: Not applicable.		

**48 Generation 3 power steering - steering stiff after engine start
(2021189/5)**

Model(s)	Year	Vehicle Specific Equipment
A3, TT	2009–2013	Not Applicable
Condition: • Steering feels stiff after engine start on vehicles with generation 3 steering. • The following entries may be stored in the power steering control module, J500 (address word 44): ◦ DTC 16344 with fault symptom 14 (Control module - faulty) ◦ DTC 16353 with fault symptom 14 (Control module - faulty) ◦ DTC 16355 with fault symptom 14 (Control module - faulty) ◦ DTC 16347 with fault symptom 07 (Control module - short circuit to ground) ◦ DTC 16347 with fault symptom 14 (Control module - faulty) Production Solution: New software.		

Pending Service Solutions

No new Pending Service Solutions this week.

[Back to top](#)

Campaigns

No new campaigns this week.

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

[Back to top](#)

© 2015 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.