

[Newsletter](#) section in the Technician References menu.

Audi
Truth in Engineering



Audi Elsa Newsletter

Edition 129: March 30, 2015

Content

- [Technical Bulletins](#)
- [Pending Service Solutions](#)
- [Campaigns](#)
- [Updates](#)
- [Suggestions](#)



Technical Bulletins

66 Wind noise from exterior rear view mirror (2026997/5)		
Model(s)	Year	Vehicle Specific Equipment
Q5, Q7	2015	Not Applicable
Condition: Customer may report hearing wind noise from the front door area. After diagnosis, it is determined that the source of the wind noise is the exterior rear view mirrors.		
Production Solution: No changes to production have been made, as no issue has been identified for vehicles in the production range for which this TSB appears.		

[Back to top](#)

10 Engine replacement, checking for debris lodged in transferred assemblies (2018288/5)		
Model(s)	Year	Vehicle Specific Equipment
All	1998–2016	Not Applicable
Condition: Prior to engine replacement, any debris lodged in transferred assemblies must be removed. Production Solution: Not applicable.		

17 Engine oil consumption - Customer complaints, 3.0T TFSI Model Year 2009–2012 (2030197/14)		
Model(s)	Year	Vehicle Specific Equipment
S4, S5 Cabriolet, A6, A7, Q7	2009–2012	3.0 TFSI
Condition: Customer complains of excessive oil consumption. Production Solution: Crankcase pressure reduction starting with model year 2013.		

46 Rattling noises from front axle on uneven roads (brake disc) (2035113/5)		
Model(s)	Year	Vehicle Specific Equipment
A8	2011–2013	PR 1LJ and PR 1LP
SQ5	2014	PR 1LV
Condition: Customer may report hearing rattling noises from front axle when vehicle is driven on uneven roads. Production Solution: Not applicable.		

27 Vibrations felt at 1000 rpm and 3000 rpm (2036392/4)		
Model(s)	Year	Vehicle Specific Equipment
S6, S7, RS 7, A8, S8	2013–2015	4.0 TFSI
Condition: - Vibrations are felt at 1000 rpm and 3000 rpm. - The following DTCs may be stored in the subframe mount control module, J931 (address word BA): - DTC B201000 (No basic setting)		

- DTC B200500 (Data record invalid)

Production Solution: Optimized J931 control module software.

91 Audi music interface (AMI): iOS & Android cable compatibility overview (2038824/2)

Model(s)	Year	Vehicle Specific Equipment
All	2007–2017	Audi music interface (AMI)

Condition:

- The following message appears on the MMI display: “Device or cable type not supported”.
- The AMI cable being used is a genuine Audi-branded cable with an Audi part number.

Production Solution: Not applicable.

91 MMI3G+ Bluetooth security profile for voice training, stored contacts, navigation favorites, and myAudi PIN (2036575/2)

Model(s)	Year	Vehicle Specific Equipment
A4, A5, A5 cabriolet, Q5	2013–2016	MMI Navigation
A8	2010–2017	MMI Navigation
A6, A7	2012–2015	MMI Navigation
Q7	2012–2016	MMI Navigation
Q3	2015–2017	MMI Navigation

Condition: One of the following conditions may be present in vehicles with MMI3G+ Navigation, and in vehicles with or without Audi connect:

- The addresses and contacts stored in the Navigation >> Favorites, Navigation >> Directory, and Navigation >> Last destinations submenus disappear intermittently.
- Intermittently, the MMI system does not appear to remember that the user’s myAudi PIN has already been entered, and it requires the user to enter the PIN again.
- The voice recognition system does not easily recognize commands spoken by the driver. This condition can be consistent or

intermittent.

Production Solution: Not applicable.

**87 Air conditioning does not cool and/or compressor is noisy
(2038023/2)**

Model(s)	Year	Vehicle Specific Equipment
A3, A3 Cabriolet	2015	Not Applicable
Condition:One or more of the following conditions are exhibited: • The air conditioning does not cool, or the cooling performance is very weak. • The air conditioning system cools, but the compressor is noisy. The noise is characterized as a grinding or groaning noise. • Either symptom may be intermittent. • No DTCs are stored. Production Solution: The Denso A/C compressor is currently being installed in production. An improved N280 valve for the Sanden A/C compressor is in development, as the installation of Sanden compressors for production will resume in the future.		

Pending Service Solutions

No new Pending Service Solutions this week.

Campaigns

REVISION: 24AP - Fuel Injection System Leak					
Model(s)	Year	Eng. Code	Trans. Code	VIN Range From	VIN Range To
S4, S5, Q7	2011–2012	3.0L TFSI	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
A6	2012	3.0L TFSI	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa

A7	2012–2013	3.0L TFSI	All	See Campaign/Action screen in Elsa	See Campaign/Action screen in Elsa
<u>Revision Summary</u> Clarified steps in repair instructions. Due to a combination of production tolerance issues and vehicle vibration during dynamic driving, it is possible that, in rare cases, a fuel leak may occur in the vehicle's fuel injection system. Leaking fuel, in the presence of an ignition source, may result in a fire. Additionally, some vehicles may benefit from having the thermostat and/or the crankcase pressure valve updated. Repairs to these other components are not related to the safety recall, but can be easily performed at the same time as recall repair.					

Updates

No new updates this week.

Suggestions

Please send comments or suggestions to: aoa.workshopinformation@audi.com

[Back to top](#)

© 2015 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.