Technical Service Bulletin



34 Creaking noise from the left front side of the vehicle, especially in cold temperatures

34 15 18 2029665/3 February 13, 2015. Supersedes Technical Service Bulletin Group 34 number 12-11 dated November 14, 2012 for reasons listed below.

Model(s)	Year	VIN Range	Vehicle-Specific Equipment	
TT RS	2012	All	Not Applicable	

Condition

REVISION HISTORY				
Revision	Date	Purpose		
3	-	Revised header data (Added VIN break)		
		Revised title		
		Revised Production Solution (Removed VIN break)		
		Revised Warranty (Updated TU)		
2	11/14/2012	Revised Parts (Added associated bolts)		
1	5/29/2012	Original Publication		

• A creaking noise is heard from the left front side of the vehicle.

- The noise is more noticeable in colder weather.
- The noise can clearly be heard at load change.

Technical Background

Relative movement in the lengthways transmission mount cause the creaking noise.

Production Solution

Optimized gearbox mounting in production.

Service

Use chassis ears to confirm that the noise is from the transmission mount. Once confirmed, replace the transmission mount and verify the repair.

Page 1 of 2

^{© 2015} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Warranty

Claim Type:	Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only.					
Service Number:	3440					
Damage Code:	0020					
Labor Operations:	Bonded rubber mounting remove and reinstall	3440 1900	110 TU			
Diagnostic Time:	GFF	No allowance	0 TU			
	Road test prior to service procedure	0121 0002	10 TU			
	Road test after service procedure	0121 0004	10 TU			
	Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DADP allowance details)					
Claim Comment:	As per TSB #2029665/3					

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual*. Claims are subject to review or audit by Audi Warranty.

Required Parts and Tools

Part Number	Part Description	Quantity
8J0199555H	Transmission mount	1
N 10513102	Bolt	3
N 90596906	Bolt	4

Additional Information

All parts and service references provided in this TSB (2029665) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2015 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.