Technical Service Bulletin

01 MIL on (DTC P1B1C); message in information panel: "Coolant System: Fault Turn Off Engine"

01 15 24 2040491/1 June 9, 2015.

| Model(s) | Year | VIN Range | Vehicle-Specific Equipment |
|----------|-------------|-----------|----------------------------|
| All | 2012 - 2015 | All | 3.0T |

Condition

- MIL on.
- The following warnings appear in the information panel:
 - "Coolant System: Fault Turn Off Engine"
 - Coolant symbol (Figure 1).
- The following DTC is stored in the engine control module (ECM), J623 (address word 01):
 - DTC P1B1C00 (Coolant pump mechanical malfunction)

Technical Background

The condition is caused by one of the following scenarios:

- Scenario A: There is a defect with the thermostat (in model year 2012 and 2013 vehicles)
- Scenario B: The diagnostic software is incorrectly displaying the warning. No technical issue exists.

Production Solution

- Scenario A: Improved thermostat installed in production.
- Scenario B: The diagnostic software has been updated.



Audi

Figure 1. Coolant symbol.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Service

1. Check Coolant Temperature in freeze frame data:

| Engine speed | 958.0 | 1/min |
|---------------------|------------------|-----------|
| Normed load value | 13.33 | % |
| Vehicle speed | 107 | km/h |
| | | |
| Coolant temperature | 102 | °C |
| Coolant temperature | 102 18 | °C |

- If coolant temperature is 115°C or higher, Scenario A applies. Replace the thermostat and update the ECM software.
 - If coolant temperature is less than 115°C, Scenario B applies. Update the ECM software only.

SVM Update Instructions

- 1. Follow all instructions in TSB 2011732: 00 Software Version Management (SVM), operating instructions.
- 2. Update the ECM (J623) using the SVM action code as listed in the table below if necessary.

© 2015 Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

| Model | Engine | Old Software Part Number | Old Software Version | New Software Part Number | New Software Version (or higher) | SVM Code Input |
|-------------------------|-----------|-----------------------------|-------------------------|-----------------------------|--|----------------------|
| | 3.0L TFSI | 4G0907551A | All | 4G0907551A | 0008 | 02A210 |
| A6, A7 | | 4G0907551D | | 4G0907551D | 0004 | |
| | | 4G0907551J | | 4G0907551J | 0003 | |
| | | 8K5907551C | | 8K5907551E | 0003 | |
| | 3.0L TFSI | 8K5907551E | | 8K5907551E | 0003 | |
| A4, A5, A5 cabriolet | | 8K5907551F 8K5907551G | All | 8K5907551G | 0005 | 02A210 |
| A8 | 3.0L TFSI | 4H0907551G | All | 4H0907551G | 0004 | 02A210 |
| | 3.0L TFSI | 8R0907551E | All | 8R0907551F | 0005 | 02A210 |
| | | 8R0907551F | | 8R0907551F | 0005 | |
| Q5 | | 8R0907551D | | 8R0907551G | 0005 | |
| | | 8R0907551A | | 8R0907551A | 0002 | |
| | | 8R0907551G | | 8R0907551G | 0005 |] |

Page 3 of 5

© 2015 Audi of America, Inc. All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Technical Service Bulletin

Warranty

| | - | | | | |
|-------------------|---|-----------------|--|--|--|
| Claim Type: | Use applicable claim type. If vehicle is outside any warranty, this Technical Service Bulletin is informational only. | | | | |
| Service Number: | For Scenario A: 1950 For Scenario B: 2470 | | | | |
| Damage Code: | 0010 | | | | |
| Labor Operations: | For Scenario A: | | | | |
| | Thermostat remove+reinstall (For A4, A5, A6, A7) | 1958 1991 | 250 TU | | |
| | Thermostat remove+reinstall (For A5 cabriolet, A8, Q5) | 1958 1991 | 220 TU | | |
| | Compressor remove+reinstall (For A6, A7, A8) | 2114 1941 | 160 TU | | |
| | Compressor remove+reinstall (For A4, A5, A5 cabriolet, Q5) | 2114 1941 | 190 TU | | |
| | Software update | 2470 2599 | 40 TU | | |
| | For Scenario B: | | | | |
| | Software update | 2470 2599 | 40 TU | | |
| Diagnostic Time: | GFF | 0150 0000 | Time stated on diagnostic protocol | | |
| | | | (Max 30 TU) | | |
| | Road test prior to service procedure | No allowance | 0 TU | | |
| | Road test after service procedure | 0121 0004 | 10 TU | | |
| | Technical diagnosis at dealer's discretion (Refer to Section 2.2.1.2 and Audi Warranty Online for DAD | P allowance det | ails) | | |
| Claim Comment: | | | | | |
| | 1 | | | | |

All warranty claims submitted for payment must be in accordance with the *Audi Warranty Policies and Procedures Manual.* Claims are subject to review or audit by Audi Warranty.

^{© 2015} Audi of America, Inc.

All rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.



Required Parts and Tools

| Part number | er Part Description | |
|-------------|--|-----|
| 06E121111AL | Thermostat (only if scenario A applies) | 1 |
| G 13A8J1G | Coolant | 0.5 |

Additional Information

All parts and service references provided in this TSB (2040491) are subject to change and/or removal. Always check with your Parts Department and service manuals for the latest information.

© 2015 Audi of America, Inc.

all rights reserved. Information contained in this document is based on the latest information available at the time of printing and is subject to the copyright and other intellectual property rights of Audi of America, Inc., its affiliated companies and its licensors. All rights are reserved to make changes at any time without notice. No part of this document may be reproduced, stored in a retrieval system, or transmitted in any form or by any means, electronic, mechanical, photocopying, recording, or otherwise, nor may these materials be modified or reposted to other sites, without the prior expressed written permission of the publisher.