

# Tech Tips

TT 60-07-01

Date: 2007

2007-2015 EOS - Water Leak From the "A" Pillar Area

February 13, 2015: Update to Model Year.

1) For concerns with water leaks from the "A" pillar trim area –

- Remove the trim and check the sunroof drain hoses.
- Inspect the area between the hose and the grommet for leaks.
- If there is evidence of leaks in this area, reseal with 3M 08690 Urethane (see figure 1).

2) For concerns with water leaks from the "A" pillar side and/or dome lamp area –

- Check at the sunroof drain hose clip location.
- An improperly clipped or pinched hose may reduce the water flow causing the water to backup and overflow into the vehicle (see figure 2).



Figure 1



Figure 2