

Tech Tips

TT 61-07-110

Date: 2007

2007-2015 EOS - Water Leak behind Exterior Mirror Triangle Seal

February 13, 2015: Update to Model Year.

For customer concerns of water leaks behind the exterior mirror, please verify the location of the leak using the test procedures described in Tech Tip 61-07-16. If leak is verified and pinpointed to this area, perform the following steps:

- Check window adjustment is even with top of mirror triangle (see first picture) and inclination of glass is tight against the seal. If uneven, perform window adjust per ELSA and reset basics settings. Retest for leak.
- Inspect for any burrs on the top edge of mirror triangle seal on the door. If present, lightly sand with 150 grit sandpaper and retest for leak.
- Build up "A" pillar seal using butyl (AKL 45000505) to increase tension to mirror seal (see picture 2).
- If a leak still persists after following the above steps, please contact the Volkswagen Technician's Helpline.

