

# Tech Tips

TT 96-15-02

Date: February 27, 2015

## 2013-2015 Tiguan-Alarm Horn Tone Weak or Abnormal When Locking

Before replacing the alarm horn (part number 5C0951115) for a weak, muffled, or abnormal tone condition, ensure the nut that secures the alarm horn bracket to the vehicle body (number 3 in the illustration below) is properly torqued. According to the Elsa Repair Manual, the specified torque for the securing nut is 20 Nm.

