



Tech Tips

TT 45-11-01

Date: November 18, 2011

2010-2014 CC, Golf, GTI, EOS, Jetta, Jetta Sportwagen,
Tiguan, 2012-2013 Beetle, Passat – Airbag Light On with Fault
B10B300 or 03551 Stored, ABS Faults

January 9, 2015: Update to Model Year.

Both the Anti-lock Brake (ABS) and Airbag systems work together. Should a fault occur in either system, address the Anti-lock Brake fault first. A fault in the ABS module could produce a fault B10B300 “Function restriction of seat occupied recognition due to implausible message” or 03551 “Function restriction of seat occupied recognition” in the airbag system, which indicates a concern with ABS. Do not replace airbag components for fault B10B300 or 03551.