

Service Information

Workshop Equipment

Number: VSE-15-27

Subject: T10542/2 – Threaded Stud from High Voltage
Adapter Set – **Special Notice**

Date: December 3, 2015

Supersedes VSE-15-25 due to updated title to “Special Notice”.

PLEASE DISTRIBUTE AND READ IMMEDIATELY!

STOP USE OF TOOL IMMEDIATELY! RISK OF INJURY!



The T10542/2 Threaded Studs included in the T10542 adapter set sold by Matra between October 2014 and July 2015 do not meet the specified design. The affected T10542/2 studs are marked “**C 14 / MA**”, as shown in the picture above. There are two T10542/2 Threaded Studs in each T10542 Adapter set.

We would like to explicitly state that using the non-replaced version entails a risk of injury that may lead to bodily harm. For this reason, the affected T10542/2 Threaded Studs may not be used under any circumstances!

Until the affected T10542/2 Threaded Studs have been successfully replaced, the high-voltage battery may only be lifted with the T10542/1 adapter in combination with the vehicle's original screws. The bolted connection must be tightened to 40 Nm. Follow the Elsa Repair Manual!

Please do not dispose of these tools, store them in a safe location until further notice. We will inform you of the replacement procedure in a separate notification in the near future. Thank you very much for your support.